APPENDIX A

STATEMENT OF WORK FOR

Stibnite Mine Time Critical Removal Actions and Non-Time Critical Removal Actions

STIBNITE MINE SITE VALLEY COUNTY, IDAHO

This Statement of Work (SOW) is Appendix A to the Administrative Settlement Agreement and Order on Consent (ASAOC) for implementation of response actions at the Stibnite Mine Site (hereafter referred to as "the Site"). The purpose of this SOW is to identify time critical and non-time critical removal actions at Source Areas at the Stibnite Mine Site.

The description of the technical work described herein is intended to provide information to the Respondents for the purpose of implementing the ASAOC. All terms used in this SOW shall be interpreted in a manner consistent with the definitions provided in the ASAOC. Any discrepancies between the ASAOC and the SOW are unintended, and whenever necessary the ASAOC will govern any interpretative disputes. This SOW is also consistent with both the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA) and the National Oil and Hazardous Substances Pollution Contingency Plan (NCP).

This SOW sets forth the requirements for conducting investigation, design, and removal actions at Source Areas at the Site. Work under this SOW has been divided into three phases: Work in Phase 1 must be completed under the ASAOC. The Work in the subsequent Bridge Phase, Phase 2, and Phase 3 are not required under the ASAOC until the Respondents elect to do that Work as provided in the ASAOC, and the Agencies agree to the performance of the Work by Respondents. No removal or remedial actions have been chosen for the optional phases. The United States Environmental Protection Agency (EPA) and United States Forest Service (USFS) (the Agencies) will identify specific removal actions, if any, to be carried out at a Source Area in the optional phases after completion of the prior phase. As described in this SOW, Work set forth in this SOW is focused on addressing Waste Material in waste rock, tailings, and mine water at the Source Areas identified in Attachment 1.

The Agencies may, at their discretion, modify the timeframe set forth in this SOW for completion of Phase 1 and the optional Bridge Phase, and optional Phases 2 and 3. Actions to be performed in areas that are subject to mining and reclamation activities performed pursuant to an approved mine plan of operations (or "mine plan", "Plan of Restoration and Operations", or "PRO"), permits, and authorizations under state or other federal authorities are outside the scope of this agreement and not authorized by, covered by, nor subject to the terms of this ASAOC and SOW.

Once Respondents have committed to performing a particular phase of work, and after the necessary approvals, permits, and authorizations have been obtained for mine operations, Respondents may choose to conduct certain activities set forth in this SOW under an approved mine plan and/or a Clean Water Act (CWA) permit. Once Respondents make this election, the activities will be removed from the scope of the ASAOC and SOW.

1.0 General Requirements

1.1 Oversight

Respondents' work conducted under the SOW will be overseen jointly by the Agencies and the Agencies' respective roles and responsibilities shall be addressed in a separate Memorandum of Understanding.

Respondents shall submit all documents and deliverables required as part of this SOW to the Agencies for their review and approval. Work will not be initiated until deliverables associated with that Work are reviewed and approved by the Agencies.

Throughout implementation of the Work, Respondents shall prepare and submit Quarterly Progress Reports to the Agencies to aid in project planning. The Reports shall list deliverables submitted during the quarter; summarize and provide the results of all data collected and of all analytical laboratory results received; and describe the actions and decisions taken, problems encountered, and activities scheduled during the upcoming quarter. Quarterly progress reports shall also summarize the extent to which the procedures and dates set forth in the ASAOC and SOW are being met. The parties may also hold more frequent meetings (for example, monthly), and may adjust the frequency of meeting as needed to accommodate current activities to implement the ASAOC.

1.2 Work Phases

Work under this SOW has been divided into three phases:

- Work in Phase 1 is required under the ASAOC and will be implemented as a Time Critical Removal Action (TCRA).
- The activities in the Bridge Phase are optional until the Respondents elect to perform them, and the Agencies agree to the performance of the Bridge Phase Work by Respondents.
- Phase 2 and Phase 3 are optional until the Respondents elect to perform them, and the
 Agencies agree to the performance of the Phases by Respondents. Phase 2 and 3 Work will be
 conducted as Non-Time Critical Removal Actions, and will be performed consistent with the
 SOW, any amended SOW, and approved Work Plans.

Table 1 describes the estimated timing of the ASAOC phases and potential mine activities assuming, that approvals and permits for mine operations are issued and mining proceeds accordingly. Attachment 1 lists Source Areas with Waste Material that may be addressed by this agreement.

2.0 Phase 1 – ASAOC Removal Actions (ASAOC Years 1 - 4 / 2020 - 2024)

2.1 Purpose

Phase 1 removal actions will occur during the mine permitting process and pre-mining activities. Phase 1 includes both time critical removal actions and time critical studies at several adits, as well as planning to inform potential removal actions in later phases. Phase 1 actions are described briefly in this section. Additional details are provided in Section 2.5. An overview of the Site is provided in Figure 1.

2.2 Phase I TCRA Projects

The Respondents shall develop three detailed TCRA Work Plans, the associated design packages, and a Project Schedule for the Agencies' review and approval. After the Agencies' approval, the Respondents shall implement the TCRAs. TCRAs shall include the following actions:

- Stream Diversion Project: Interim measures to divert upgradient water around three historic mining features: NW Bradley Dumps / Hennessy Creek, the Defense Minerals Exploration Administration (DMEA) Waste Rock Dump, and Smelter Flats/Hangar Flats¹. Stream diversion actions shall take into consideration the March 2013 USFS guide entitled, "Planning and Layout of Small-Stream Diversions.," A TCRA Work Plan and design package for the alignment of the diversions, shall define the Means and Methods used to divert water and the discharge areas, shall be prepared by the Respondents for review and approval by the Agencies prior to construction. Water diversions shall be designed to divert clean water from the following Source Areas:
 - The Northwest Bradley Dumps consist of extensive waste rock dumps covering over 30 acres along the East Fork of the South Fork of the Salmon River (EFSFSR) southwest of the confluence with Sugar Creek. Hennessy Creek currently leaks from a ditch system and infiltrates upgradient of the Northwest Bradley Dumps. Respondents' existing technical analyses indicate that this water likely infiltrates through waste rock in the dumps, potentially contributing to the elevated metals concentrations observed in the EFSFSR.
 - The DMEA Waste Rock Dump Area is on the western side of the EFSFSR valley approximately 0.75 miles south of Fiddle Creek. Respondents' analyses of existing data suggest that seeps from the DMEA Waste Rock Dump contribute to elevated metals concentrations at monitoring station YP-T-17. Work in this area will evaluate the potential for multiple seeps and water sources, e.g. manifestation of adit seeps (e.g. upper and lower seeps) versus surface flow contacting mine waste. If this is identified as a data gap, it will be described in the Site Characterization and Data Gaps Report (Section 2.3).
 - o Smelter Flats/Hangar Flats is the site of former mineral processing activities in Meadow Creek valley approximately 0.75 miles southwest of the EFSFSR confluence. The area is southwest of the Hecla heap leach pad, and northwest of the Spent Ore Disposal Area (SODA) and Bradley Tailings Pile, and groundwater and seeps from this area impact water quality in Meadow Creek.
- Waste/Sediment Removal and On-Site Repository Project: Remove approximately 300,000 tons (of the approximately 15 million tons at the Site)² of contaminated Waste Material from streambanks and/or floodplains. Based on the arsenic loading from various source locations identified in Attachment 1 the sources shall be addressed sequentially from upstream to downstream. Sequencing of the Waste Material removal from upstream to downstream is essential. If downstream areas are cleaned up first, then they would likely be re-contaminated by releases of hazardous materials from upstream sources. The Keyway Dam and Marsh Area is a major source of metals from legacy tailings and the main source of suspended sediment from

¹ Also known as the Bradley Mill and Smelter and the Meadow Creek Mill and Smelter.

² Midas Plan of Restoration and Operations

the failure of the former tailings storage facility; therefore, remediation of the Keyway Dam and Marsh Area shall be conducted first to provide immediate benefit to downstream fish habitat.

- o If the Keyway Dam and Marsh Area removal has been completed and less than 300,000 tons have been removed, then contaminated sediments in streams or floodplains shall be removed from further downstream locations: the Bradley Man Camp Dumps, the Bradley NE Oxide Dumps, and finally, the BMC Northwest Bradley Waste Rock Dumps and areas adjacent to and SW of the Yellow Pine Pit. Respondents shall define the Means and Methods for removal as well as performance goals and associated industry standards. In addition, Respondents shall design and construct an on-site repository to accommodate the volume of Waste Material identified in the TCRA Work Plan for the waste/sediment removal project. Respondents shall site the repository in an uplands area with stable slopes, design a low-permeability foundation with underdrain and leachate collection layers, and submit construction QA/QC and Operations Monitoring and Maintenance Plans for the facility.
- Adit Study: Conduct baseline studies of Mine Influenced Water (MIW) at five adits: Bailey Tunnel, DMEA Adit, Bonanza Adit, Cinnabar Tunnel, and Meadow Creek Adit. Respondents shall take measurements of water quality, quantity and geotechnical data needed to inform removal actions. This data will be used to provide baseline conditions and seasonal measurements of current (pre-dewatering) and expected post closure groundwater quality, quantity elevations and flow. Initiating baseline studies to inform the design of removal action alternatives for the following existing mine features (ranked by relative arsenic load to surface water): Bailey Tunnel Adit, Meadow Creek Mine Adit, Cinnabar Tunnel Adit, DMEA Adit, and Bonanza Adit. The baseline studies for removal actions would include drilling and installing monitoring wells to measure groundwater elevations, installing surface water flow measurement weirs or flumes, continuously measuring hydraulic pressure, collecting water quality parameters including specific conductivity, temperature, pH, and seasonally measuring metals and suspended solids concentrations.

The TCRA Work Plans shall include, at a minimum, background information relevant to the project area, removal action objectives, identification of a preferred alternative, identification of ARARs, and summary of the Site conditions.

Design Packages shall include a basis for the design, specifications, drawings, supporting calculations, and construction quality control/quality assurance requirements for delineation of the excavation limits, and the basis for that delineation; method for determining when the depth and lateral extent of removal is sufficient; drainage design; repository design including mass balance calculations; permanent stormwater control; liner/cover requirements, geotechnical evaluation; hauling plan; means and methods for conducting the work including survey control, dust control, stormwater and erosion control during TCRA implementation, spill control/cleanup; and health and safety plans.

Data Analyses, Removal Action Area Investigations, and associated Time Critical Removal Action Work Plans and Design Packages:

 Using existing data compiled and/or collected by the Respondents at the time the ASAOC is signed, the Respondents shall develop a Site Characterization Report and Data Gaps Analysis. No data collection is necessary for this element of the SOW. Provide all data related to Waste Material at the Site to the Agencies in electronic format (e.g., Microsoft Excel or Access files for contaminant data and GIS files for maps).

- TCRA Work Plan and Design Package for diverting upgradient water around three historic mining features: NW Bradley Dumps / Hennessy Creek, the DMEA Waste Rock Dump, and the former Smelter Flats/Hangar Flats.
- TCRA Work Plan and Design Package for Waste/Sediment Removal and On-Site Repository Project. Respondents will develop a TCRA Work Plan, including a Quality Assurance Project Plan (QAPP) which includes elements of both a Sampling and Analysis Plan (SAP) and a Field Sampling Plan (FSP) to guide the collection of any additional data needed for the purpose of implementing the Phase 1 waste/sediment removal action. The TCRA Work Plan will include an evaluation of options for removing up to 500,000 tons (300,000 tons for Phase I, potentially 200,000 under the Bridge Phase) of Waste Materials from the shoreline and floodplain areas of the EFSFSR, Meadow Creek, and other tributary streams. Respondents will propose the location of Waste Material from the following Source Areas: the Keyway Dam and Marsh Area, the areas impacted by the Bradley Man Camp Dumps, the Bradley NE Oxide Dumps, and the BMC Northwest Bradley Waste Rock Dumps, and areas adjacent to and SW of the Yellow Pine Pit. The TCRA Work Plan and Design Package will also evaluate options and provide the detailed design for the on-Site disposal of up to 500,000 tons of Waste Material (to accommodate another 200,000 tons if Respondents agree to carry out additional excavation and disposal under optional Bridge phase or Phase 2).
- TCRA Work Plan for characterization of Adit Discharges. Respondents will develop a TCRA Work Plan, including a QAPP, to guide baseline studies of Mine Influenced Water (MIW) at five adits: Bailey Tunnel, DMEA Adit, Bonanza Adit, Cinnabar Tunnel, and Meadow Creek Adit. The studies will include measurements of volumetric flow and contaminant concentrations in water discharged from the adits, as well as geotechnical evaluations as needed to inform potential removal actions. Respondents will develop a Removal Alternatives Analysis (RAA) Report, in which they will evaluate data and potential response actions for each of the five adits.

2.3 WORK APPROACH AND KEY DELIVERABLES

Deliverables specified in this SOW shall be consistent with the NCP and appropriate EPA policy and guidance. Except where noted below, deliverables for removal actions shall include preparation, delivery of a draft, incorporation of the Agencies' comments, and finalization of the following:

- 1. Site Characterization Report and Data Gaps Analysis using existing data.
- 2. TCRA Work Plans (as described above and in Section 2.5) including QAPP and Construction Quality Assurance Plan (CQAP) (draft and final), as appropriate.
- 3. TCRA Design Documents (as described above and in Section 2.5).
- 4. Biological Assessment (BA), Clean Water Act (CWA) Section 404 Evaluation, and Cultural Resources Survey (may be included in the TCRA Work Plan for the Interim Water Diversion Removal Action, as identified in Section 2.5).
- 5. Waste/Sediment Removal Action Area Characterization Report. Adit Removal Action Area Discharge Characterization Report³.

³ TCRAs in Phase 1 to divert water around the NW Bradley Dumps / Hennessy Creek, Smelter Flats / Hangar Flats, and the DMEA Waste Rock Dump do not require a Removal Action Area Characterization Report.

- 6. Removal Alternative Analysis Report for the Adits.
- 7. Implementation of Removal Actions and weekly report documentation.
- 8. Removal Action implementation data including but not limited to field monitoring, laboratory analysis, geotechnical investigations, survey documentation.
- 9. Removal Action Completion Report(s).
- 10. Quarterly Progress Reports.
- 11. Post-Removal Site Control Report and Plan.

Table 2 provides a general schedule of deliverable deadlines for Phase 1 of this ASAOC/SOW. Data submittal requirement are defined in the following sections.

2.3.1 General Requirements for Deliverables

Respondents shall submit all deliverables required by this SOW, or any approved work plan, to Agencies in accordance with the schedule set forth in Table 2.

Respondents shall submit all deliverables in electronic form. Technical specifications for sampling and monitoring data and spatial data are addressed in Section 2.3.2. All other deliverables shall be submitted to the Agencies in the form specified by the OSC. If any deliverable includes maps, drawings, or other exhibits that are larger than 8.5×11 inches, Respondents shall also provide the Agencies with paper copies of such exhibits.

2.3.2 Technical Specifications for Deliverables

Sampling and monitoring data should be submitted in standard Regional Electronic Data Deliverable (EDD) format (see Region 10 Data Management Plan, Appendix B Data Element Dictionary). Other delivery methods may be allowed if the Agencies approve them in advance.

Spatial data, including spatially-referenced data and geospatial data, shall be submitted: (a) in the ESRI File Geodatabase format; and (b) as unprojected geographic coordinates in decimal degree format using North American Datum 1983 (NAD83) or World Geodetic System 1984 (WGS84) as the datum. If applicable, submissions should include the collection method(s). Projected coordinates may optionally be included but must be documented. Spatial data should be accompanied by metadata, and such metadata should be compliant with the Federal Geographic Data Committee (FGDC) Content Standard for Digital Geospatial Metadata and its EPA profile, the EPA Geospatial Metadata Technical Specification. An add-on metadata editor for ESRI software, the EPA Metadata Editor (EME), complies with these FGDC and EPA metadata requirements and is available at https://edg.epa.gov/EME/.

Each file must include an attribute name for each site unit or sub-unit submitted. Consult http://www.epa.gov/geospatial/geospatial-policies-and-standards for any further available guidance on attribute identification and naming.

Spatial data submitted by the Respondents does not, and is not intended to, define the boundaries of the Site.

2.3.3 Electronic Database Requirements

Environmental sample data and related site physical data (e.g., water quality field measurements) shall be compiled and provided to the Agencies in a Scribe electronic database. Scribe is a free environmental

data management tool developed and maintained by the EPA, which is capable of producing the EDDs specified in Section 2.3.2. Additional details on Scribe data entry are provided in Attachment 2.

2.4 GENERAL TASKS TO BE IMPLEMENTED DURING PHASE 1

Health and Safety Plan (HASP)

Respondents shall develop a HASP designed to protect on-site personnel, area residents and visitors to the removal action areas from physical, chemical, biological, and all other hazards posed by the removal actions in this ASAOC/SOW. The HASP shall include the following items:

- Facility Description
- Personnel
- Levels of protection
- Safe work practices and safeguards
- Personal protective equipment including a respiratory protection program if appropriate
- Medical monitoring
- Personal Hygiene
- Decontamination of personnel and equipment from Site work zones
- Contaminant control
- Stop work authority; documentation of near misses, incidents, and accidents
- Contingency and emergency planning logs, reports and record keeping
- Task-specific or activity evaluation of hazards

The HASP shall be prepared in accordance with EPA's Standard Operating Safety Guidance (PUB 9285.1-03, PB 92-963414, June 1992). In addition, pursuant to 40 CFR Part 300.150, the plan shall comply with all currently applicable Occupational Safety and Health Act ("OSHA") requirements, standards and regulations found at 29 C.F.R. part 1910; (Occupational Safety and Health Standards), Part 1926 (Construction Standards), including the General Industry Standards found in Part 1910, and the general duty requirements of section 5(a)(1)(29 U.S.C. 654(a)(1); and any other applicable safety laws and regulations. The Respondents shall submit a draft HASP to the Agencies for review. A final HASP shall be prepared that incorporates the Agencies' comments on the draft HASP. If the Agencies determine that existing HASP(s) for other areas of the Site or other activities adequately address health and safety issues, the existing plans can be referenced. However, previously prepared HASPs and the general site-wide HASP must be amended to address new job tasks and associated safety issues/hazards, and employer-specific safety requirements for the Respondents' work scope.

Site Characterization Report and Data Gaps Analysis

The Respondents shall prepare a report presenting existing Site data relevant related to Waste Material in the areas of the Site described below, including information about:

- The site's physical features and underlying geology;
- Previous mining actions, past disposal practices, and reclamation actions;
- Previous environmental investigations and removal or other cleanup actions;
- The varieties and quantities of hazardous substances at the Site, including soil, sediment, surface water and groundwater sampling results; and
- Data gaps and uncertainties that exist and may affect implementation of the TCRA.

The report shall discuss existing data related to the following Site features:

- Keyway Dam and Marsh Area
- Smelter Flats / Hangar Flats

- Meadow Creek Mine adit area
- Hecla heap leach & Pioneer tailings (NE of Hecla leach pad)
- Canadian Superior Heap Leach Pads area
- Defense Minerals Exploration Administration (DMEA) Waste Rock Dump area
- DMEA adit area
- Bradley Man Camp Waste Rock Dump area
- Areas adjacent to and NE of the Yellow Pine Pit, including Monday Camp, Monday Camp Waste Rock Dump, and SE Bradley Waste Rock Dump
- Areas adjacent to and SW of the Yellow Pine Pit, and the BMC NW Bradley Waste Rock Dump
- Cinnabar Tunnel adit area
- Northwest Bradley Waste Rock Dumps / Hennessy Creek area
- Northeast Bradley Northeast Oxide Dumps area
- Bailey Tunnel outlet area
- Bonanza adit area (Sugar Creek)
- Bonanza Dump

Site Features containing hazardous materials are documented in the Hazardous Materials Baseline Study Prepared for Midas Gold Idaho Incorporated by HDR in 2015 and updated by Brown and Caldwell in 2017⁴. The report shall include a bibliography of the studies and reports cited, and electronic copies of cited reports shall be provided to the Agencies along with the report. In addition, data compiled by the Respondents shall be provided to the Agencies in a Scribe electronic database, as specified in Section 2.3.3.

Data Validation Summaries

Data collected to support characterization and TCRA activities shall be validated in accordance with EPA guidance and policies. Data Validation Reports shall be provided to the Agencies upon completion of each sampling event.

2.5 PHASE 1 REMOVAL ACTION AND SOURCE AREA INVESTIGATION TASKS

2.5.1 Interim Water Diversion Removal Actions Planning Documents

TCRA Work Plan

Respondents shall submit a TCRA Work Plan that will include an evaluation of alternative designs for implementation of the removal action selected in the Action Memorandum (Action Memo). The selected removal action requires diversion of water around NW Bradley Dumps/Hennessy Creek, Smelter Flats/Hangar Flats, and the DMEA Waste Rock Dump. In addition to the evaluation, the TCRA Work Plan will include the following elements:

- Executive Summary;
- Introduction;
- Procedures for addressing and protecting any cultural resources in the areas in which stream diversion will occur;
- Identification of Removal Action Objectives and performance goals (e.g. for the water diversion project and adit seep project, to reduce metal concentrations in surface water downgradient of

⁴ Midas Gold, Hazardous Materials Baseline Study, April 2017.

- the identified Source Areas to prevent erosion of contaminated soils into streams and reduce dissolved metal concentrations in surface water);
- Identification of Removal Action Technologies (e.g., for the water diversion project, unlined or lined ditches, pipes; for the waste/sediment removal project, excavation equipment, bank stabilization methods, Waste Material repository containment strategies; and for the adit seep project bulkheads, water treatment, water diversion, etc.);
- Identification of Removal Action Alternatives (e.g., for the water diversion project, conveyance routing, outfall locations; and for the waste/sediment removal project, what portions of dumps and tailings are targeted for removal, potential Waste Material disposal locations, and waste haul routes);
- Evaluation of Removal Action Alternatives;
- Schedule for recommended Removal Action;
- Biological Assessment that characterizes baseline conditions of existing habitat in and around TCRA areas; addresses potential project impacts that the projects may have on threatened or endangered species, their habitat, and their food stocks; and describes best management practices and conservation measures designed to avoid or minimize any negative impacts;
- A Clean Water Act Section 404 analysis memorandum, if the recommended removal action alternative will impact jurisdictional wetlands. The memorandum shall document the information gathered regarding practicability and cost, long and short-term effects from all proposed alternatives, minimization of adverse effects, and an analysis of the need for any mitigation;
- Procedures for processing design changes and securing the Agencies' review and approval of such changes to ensure changes are consistent with the objectives of the Removal Actions; and
- Procedures for coordinating with EPA regarding compliance with EPA's Off-Site Rule, as applicable.

Project Design Documents

After the Agencies have issued the Action Memo the Respondents shall produce design documents, including construction plans and specifications, supporting calculations, QAPPs, and CQAPs to implement the Removal Actions. Respondents shall meet regularly with the Agencies prior to and during development of design documents, and provide the Agencies for review and approval, the technical documents that support the removal design.

For the water diversion project, the Respondents shall submit:

- Initial 30% Design Report
- Prefinal design when the design effort is 60 percent complete,
- Draft Final design and
- Final design when the design effort is 100 percent complete.

Prefinal Design submittals for the water diversion project shall include three separate deliverables:

- Initial (30 percent) and Prefinal (60 percent) Design Analysis Report;
- Initial (30 percent) and Prefinal (60 percent) Construction Documents and Schedule;
- Initial (30 percent) and Prefinal (60 percent) Design Plans and Specifications.

Each 30% initial report will include a concise summary of the known elements of each report. This will allow for the agencies and Respondents to agree on a course of action.

The Prefinal (60 percent) Design Analysis Report shall provide the design criteria and the basis of design for the Removal Actions. Examples of the types of information to be included are described below:

- Technical parameters and supporting calculations upon which the design will be based;
- Descriptions of the analyses conducted to select the design approach, including a justification of design assumptions and verification that the design will meet performance goals and associated industry standards;
- Access and easement requirements (if any);
- Permit requirements or substantive requirements of permits;
- Plans for reducing negative effects on the environment during construction;
- An outline of the Post-Removal Site Control; and
- Analysis and recommendations on institutional controls and/or engineering controls that may
 be implemented to ensure long-term effectiveness of the removal actions that are likely to
 remain in place through and beyond mining activities under the PRO (see "Institutional
 Controls" OSWER 9355.0-74FS-P, EPA 540-00-005, September 2000).

The Prefinal (60 percent) Construction Documents and Schedule shall include:

- Construction plans/drawings and required specifications; and
- Schedule for construction and implementation of the Removal Action that identifies major milestones.

The Prefinal (60 percent) Design Plans and Specifications shall include:

- Draft Construction Drawings;
- Draft Technical Specifications; and
- Draft CQAP, detailing the remediation verification method and approach to quality assurance
 during construction activities in the project area. The CQAP will describe in detail the
 construction quality criteria and tolerances, field and laboratory testing and inspection
 requirements, methods for direct measurement to be made during construction to ensure
 removal action objectives and performance goals and associated industry standards will be met,
 and methods for resolving nonconforming conditions. Attachment 3 lists EPA guidance for CQAP
 preparation.

The Draft Final (100 percent) Design package shall include:

- Draft Final Design Analysis Report;
- Draft Final construction documents and schedule;
- Draft Final CQAP;
- Draft Operation, Maintenance, and Monitoring Plan; and
- Draft Final cost estimate for the Removal Action and estimated cost for long-term monitoring.

The Final (100 percent) Design package shall include:

- Final Design Analysis Report;
- Final construction documents and schedule;
- CQAP;
- · Operation, Maintenance, and Monitoring Plan; and
- Final cost estimate for the Removal Action and estimated cost for long-term monitoring.

The final design shall fully address all the Agencies' comments made on the conceptual (e.g. 30%) and prefinal design (60%). The final design package shall be stamped by licensed Professional Engineer, registered in the State of Idaho.

A statement of qualifications for the construction contractor will be prepared after completion of the design documents and submitted for review and approval by the Agencies. The statement of qualifications for the construction contractor shall identify the appropriate areas of construction expertise including years of experience on projects with similar scope, size, and quality requirements to successfully implement the TCRA.

2.5.2 Waste/Sediment Removal and Repository Planning Documents

TCRA Work Plan

Respondents shall submit a TCRA Work Plan that will evaluate and recommend actions to remove 300,000 tons of Waste Material from any of the following areas, in the following order or priority: the Keyway Dam and Marsh Area, the Bradley Man Camp Dumps, the Bradley NE Oxide Dumps, and the BMC Northwest Bradley Waste Rock Dumps (i.e., areas adjacent to but not within the Yellow Pine Pit). In anticipation of the Optional Bridge Phase, the report must also evaluate and recommend actions to remove an additional 200,000 tons of Waste Material, for a total removal of 500,000 tons of Waste Material from streambank and floodplain areas. The TCRA Work Plan will also evaluate and scope design of an on-site repository for long-term containment of the excavated Waste Material.

In addition to the evaluation, the TCRA Work Plan shall include a QAPP. The TCRA Work Plan shall include, at a minimum, the following information:

- Executive Summary;
- Introduction/Purpose;
- Brief description of the Stibnite mining district characteristics, including ecological and physical characteristics;
- Summary of existing information about the history and operation of the Bradley Man Camp
 Dumps, BMC Northwest Bradley Waste Rock Dumps, and areas adjacent to, but not within, the
 Yellow Pine Pit (i.e., the Keyway Dam and Marsh Area, and the Bradley NE Oxide Dumps);
- Description of the physical features and nature and extent of contamination at the dumps and tailings piles listed above, including information about the volume and areal extent of Waste Materials, the frequency and extent of flooding and interaction of the Waste Materials with the adjacent waterbodies, and an estimate of the amount of contaminants of concern (e.g., aluminum, arsenic, antimony, cyanide, iron, manganese, mercury, and thallium) released annually from Source Areas through erosion and dissolved contaminant transport;
- Performance goals. Field survey of the floodplain and Waste Materials are necessary to
 implement Phase I removal actions including mapping the topography, presence of Waste
 Material in the stream and floodplain, nearby wetlands, and measuring surrounding grades and
 soil types so that temporary stream diversion can be designed and sediment control measures
 planned. Once final removal action locations are chosen, additional field survey of surrounding
 slopes will be necessary to design for slope and sediment stability once Waste Material is
 removed;
- Identification of the specific areas from which Respondents propose to remove Waste Material
 (as described in the fourth bullet, above). Discussion of the likely removal approach for each
 area selected, including the equipment that would be needed and any new roads or other
 improvements that would be required to facilitate construction;

- Discussion of potential Waste Material disposal locations, which may include stand-alone on-site permanent waste repository(ies);
- Identification of data needed to design waste/sediment removal actions and repository
 construction, which may include engineering characteristics of the Waste Materials, potential
 slope stability issues, and siting criteria (e.g., topography, geotechnical considerations, and soil
 properties information) in and around potential waste repository locations;
- Procedures for addressing and protecting any cultural resources in the areas in which stream diversion will occur;
- Identification of Removal Action Objectives and performance goals (e.g., for the waste/sediment removal project to prevent erosion of contaminated soils into streams and reduce dissolved metal concentrations in surface water) and for construction of the waste repository((ies);
- Identification of Removal Action Technologies (e.g., for the water diversion project, unlined or lined ditches, pipes; for the waste/sediment removal and waste repository project, excavation equipment, bank stabilization methods, Waste Material repository containment strategies; and for the adit seep project bulkheads, water treatment, water diversion, etc.);
- Identification of Removal Action Alternatives (e.g., for the water diversion project, conveyance
 routing, outfall locations; and for the waste/sediment removal and waste repository project,
 what portions of dumps and tailings are targeted for removal, potential Waste Material disposal
 locations, and waste haul routes);
- Schedule for recommended Removal Action;
- A Biological Assessment that characterizes baseline conditions of existing habitat in and around TCRA areas; addresses potential project impacts that the projects may have on threatened or endangered species, their habitat, and their food stocks; and describes best management practices and conservation measures designed to avoid or minimize any negative impacts;
- A Clean Water Act Section 404 analysis memorandum, if the recommended removal action alternative will impact jurisdictional wetlands. The memorandum shall document the information gathered regarding practicability and cost, long and short-term effects from all proposed alternatives, minimization of adverse effects, and an analysis of the need for any mitigation;
- A CQAP and statement of qualifications for the construction contractor. The CQAP will describe
 in detail the methods for direct measurement to be made during construction to ensure
 removal action objectives and performance goals and standards will be met. Attachment 3
 provides relevant EPA guidance documents for CQAPs;
- Environmental Protection Plan detailing measures to minimize harm to the surrounding environment and prevent cross contamination during construction including best management practices (BMPs) for storm water management and dust control, waste management, spill control, decontamination requirements for equipment and personnel. Appropriate measures could include, for example, the use of silt fencing to reduce soil erosion into nearby waterbodies, procedures to reduce the risk of spills during onsite refueling of vehicles and equipment, and established traffic patterns to reduce the risk of vehicle accidents during construction, decontamination of haul trucks prior to traveling on clean haul roads, etc.;
- Procedures for processing design changes and securing the Agencies' review and approval of such changes to ensure changes are consistent with the objectives of the Removal Actions;
- Procedures for coordinating with EPA regarding compliance with EPA's Off-Site Rule, as applicable; and

 ARARs identification and a discussion of how the Removal Actions will meet the identified ARARs.

The procedures the Respondents plan to implement when conducting all field activities will be detailed in the approved QAPP that will be included in the TCRA work plan. The QAPP will ensure that sample collection and analytical activities are conducted in accordance with technically acceptable protocols and meet data quality objectives. The QAPP will follow the "EPA Requirements for Quality Assurance Project Plans" EPAQA/R-5 with DQOs developed and included in accordance with EPAQA/G-4, "Guidance on Systematic Planning Using the Data Quality Objectives Process". The QAPP will follow the Uniform Federal Policy (UFP) format, as described in the guidance documents listed in Attachment 3.

Waste/Sediment Removal Action Area Characterization Report

Respondents shall submit a Removal Action Area Characterization Report that includes information from field sampling events conducted to support possible removal actions including the Keyway Dam and Marsh Area, Bradley Man Camp Dumps, the Bradley NE Oxide Dumps, areas adjacent to and SW of the Yellow Pine Pit, and the BMC NW Bradley Waste Rock Dump including validated analytical results. The Removal Action Area Characterization Report shall include, at a minimum the following sections:

- Introduction/purpose;
- Summary of the field sampling effort that, at a minimum, includes field effort dates, a summary of sample collection efforts (e.g., Waste Material deposit mapping, topographic survey of the floodplain area including wetland demarcation and stream gradient, high water mark survey, and volume calculations, topographic surveying), field sample observations, and a summary of sample and station locations, with maps and figures;
- Deviations from the approved FSP; and
- Summary of all data, including a data validation report. Data from this effort shall be provided to the Agencies electronically as well as in report tables.

Project Design Documents

After the Agencies have issued the Action Memo for the waste/sediment removal and repository construction project, the Respondents will produce design documents, including construction plans and specifications, supporting calculations/justification, QAPPs, and CQAPs to implement the Removal Actions. For the repository, the design package shall include a closure plan identifying the final cap or cover requirements and Post-Removal Site Controls. Respondents shall meet regularly with the Agencies prior to and during development of design documents, and provide to the Agencies for review and approval, the technical documents that support the removal design.

For the waste/sediment removal and on-site repository project, the Respondents shall submit:

- Conceptual design when the design effort is 30 percent complete;
- Prefinal design when the design effort is 60 percent complete;
- Draft Final design; and
- Final design when the design effort is 100 percent complete.

The Conceptual Design for the waste/sediment removal project shall include an overall explanation of the selected alternative, and annotated outlines of the prefinal design analysis report, a list of anticipated plan drawings, and an annotated outline of technical specifications.

Prefinal Design submittals for the waste/sediment removal and on-site repository project shall include three separate deliverables:

- Initial (30 percent) and Prefinal (60 percent) Design Analysis Report;
- Initial (30 percent) and Prefinal (60 percent) Construction Documents and Schedule; and
- Initial (30 percent) and Prefinal (60 percent) Design Plans and Specifications.

Each 30% initial report will include a concise summary of the known elements of each report. This will allow for the agencies and Respondents to agree on a course of action.

The Prefinal (60 percent) Design Analysis Report shall provide the design criteria and the basis of design for the Removal Actions. Examples of the types of information to be included are described below:

- Technical parameters and supporting calculations upon which the design will be based;
- Descriptions of the analyses conducted to select the design approach, including a justification of design assumptions and verification that the design will meet performance goals and associated industry standards;
- Access and easement requirements (if any);
- Permit requirements or substantive requirements of permits (e.g., general construction and stormwater permits);
- Plans for reducing negative effects on the environment during construction;
- An outline of the Post Control Site Controls, and
- Analysis and recommendations on institutional controls and/or engineering controls that may
 be implemented to ensure long-term effectiveness of the removal actions that are likely to
 remain in place through and beyond mining activities under the PRO (see "Institutional
 Controls" OSWER 9355.0-74FS-P, EPA 540-00-005, September 2000).

The Prefinal (60 percent) Construction Documents and Schedule shall include:

- Construction plans / drawings and required specifications; and
- Schedule for construction and implementation of the Removal Action that identifies major milestones.

The Prefinal (60 percent) Design Plans and Specifications shall include:

- Draft Construction Drawings;
- Draft Technical Specifications; and
- Draft CQAP, detailing the remediation verification method and approach to quality assurance
 during construction activities in the project area. The CQAP will describe in detail the
 construction quality criteria and tolerances, field and laboratory testing and inspection
 requirements, methods for direct measurement to be made during construction to ensure
 removal action objectives and performance goals and associated industry standards will be met,
 and methods for resolving nonconforming conditions. Attachment 3 lists EPA guidance for CQAP
 preparation.

The Draft Final (100 percent) Design package shall include:

- Draft Final Design Analysis Report;
- Draft Final construction documents and schedule;
- Draft Operation, Maintenance, and Monitoring Plan; and

Draft Final cost estimate for the Removal Action and estimated cost for long-term monitoring.

The Final (100 percent) Design package shall include:

- Final Design Analysis Report;
- Final construction documents and schedule;
- Operation, Maintenance, and Monitoring Plan; and
- Final cost estimate for the Removal Action and estimated cost for long-term monitoring.

The final design shall fully address all Agencies' comments on the conceptual and prefinal design. The final design package shall be stamped by licensed Professional Engineer, registered in the State of Idaho.

A statement of qualifications for the construction contractor will be prepared after completion of the design documents and submitted for review and approval by the Agencies. The statement of qualifications for the construction contractor shall identify the appropriate areas of construction expertise including years of experience on projects with similar scope, size, and quality requirements to successfully implement the TCRA.

2.5.3 Adits Planning Documents

TCRA Work Plan

Respondents shall prepare and submit for the Agencies' review and approval a TCRA Work Plan for adit investigations to characterize baseline (pre-mining) conditions at the Bailey Tunnel, DMEA Adit, Bonanza Adit, Cinnabar Tunnel, and Meadow Creek Adit. The TCRA Work Plan shall include:

- Executive Summary;
- Introduction;
- A summary of existing information about the history and operation of the Bailey Tunnel, DMEA Adit, Bonanza Adit, Cinnabar Tunnel, and Meadow Creek Adit;
- Description of the physical features of these adits and the nature and extent of contamination, including information about water quality and the volumetric flow and timing of the adit discharges;
- A preliminary Conceptual Site Model (CSM) for each adit. The CSM should include known and suspected sources of hazardous material contamination, types of contamination and affected media/resources and known and potential routes of contaminant migration;
- Identification of baseline data needed to characterize discharges from the five adits listed above
 which may include but is not limited to continuous flow measurements (e.g., high and low flow
 measurements), surface water quality sampling, groundwater sampling, sediment and/or soil
 sampling, and assessments of the physical characteristics of the adits, the surrounding geology,
 geotechnical data and upgradient background conditions;
- A QAPP detailing the procedures the Respondents plan to implement when conducting all field activities, which will conform to the QAPP Guidance listed in Attachment 3;
- A Job Hazard Analysis identifying the specific tasks workers will undertake during the adit investigations, and a HASP Amendment, if needed, to ensure the safety of workers implementing the field activities; and
- Schedule.

Adit Removal Action Area Characterization Report

Respondents shall submit a draft, draft final, and final Adit Removal Action Area Characterization Report for the adit seeps that includes information from the field sampling events to characterize baseline conditions at the Bailey Tunnel, DMEA Adit, Bonanza Adit, Cinnabar Tunnel, and Meadow Creek Adit. The Report shall include, at a minimum, the following sections:

- Introduction/purpose;
- Summary of the field sampling effort that, at a minimum, includes field effort dates, a summary
 of sample collection efforts (e.g., adit discharge flow measurements, water quality sampling),
 field sample observations, and a summary of sample and station locations, with maps and
 figures;
- Summary of adit physical properties including geotechnical characteristics to be used in evaluation of adit seep remedial technologies (e.g., structures etc.);
- Deviations from the QAPP;
- Summary of all data, including a data validation report. Data from this effort shall be provided to the Agencies electronically as well as in report tables;
- Updated CSMs based on current knowledge presented in the report;
- An evaluation of when in the planned mining sequence each adit would best be addressed; and
- Outstanding data gaps that will need to be filled during Design.

Removal Alternatives Analysis Report for the Adits

Respondent shall prepare a Removal Alternatives Analysis Report (RAA) identifying and evaluating alternatives for the adit removal actions. This report will be prepared based on characterization of the adits, discharges, and shall identify and provide an initial screening of removal action technologies. Individual technologies that are retained through the initial screening process shall be assembled into removal action alternatives and presented in the RAA Report. The removal alternative analysis shall include evaluation of implementability, effectiveness, and cost criteria. This analysis will be used to develop the EE/CA(s) prepared in Phase 2 and/or 3. The removal alternative analysis shall be prepared according to EPA's 1993 *Guidance on Conducting Non-Time-Critical Removal Actions Under CERCLA*. Removal Actions recommended by the RAA Report may be implemented during optional Phase 2 after the completion of EE/CAs that evaluate adit removal alternatives.

2.6 Implementation of Removal Action

Respondents shall provide notification to the Agencies thirty (30) days prior to initiation of removal action related field work to all the Agencies to coordinate field oversight activities.

The Respondents shall complete the Removal Action in accordance with the approved Final Design documents and TCRA Work Plans. The following activities shall be conducted during construction of the Removal Action.

The Agencies and Respondents shall participate in an on-site preconstruction meeting(s) to:

• Review each construction location and confirm current site conditions;

- Review methods for documenting and reporting compliance with specifications and plans
 including methods for processing design changes and securing the Agencies' review and
 approval of such changes as necessary;
- Review methods for distributing and storing documents and reports;
- Review work area security and safety protocols, as appropriate;
- Demonstrate that construction management is in place, and discuss any appropriate modifications to the design (drawings, specifications, CQAP, QAPP, etc.) to ensure that project specific considerations are addressed; and
- Respondent shall transmit (electronically) draft key points and action items from the preconstruction meeting to all parties within seven (7) days of the meeting.

Weekly reports shall be prepared and submitted (electronically) to the Agencies for review during the Removal Action. Weekly reports shall include work performed, problems encountered, and solutions proposed, any monitoring results such as water quality monitoring, and work to be performed during the following week. If applicable, Respondents shall inform EPA of the off-Site disposal facility proposed to receive any debris or hazardous materials from the Removal Action areas and obtain approval per the CERCLA Off-Site Rule.

Depending on the repository design, independent QA oversight and certification by a licensed Professional Engineer registered in Idaho may be required. The need for independent Professional Engineer certification will be specified in the CQAP. The certification report will document that the repository liner system and/or final cap or cover system was constructed as designed.

Within seven (7) days after Respondents make a preliminary determination that construction is complete, Respondents shall verbally notify the Agencies for the purposes of scheduling prefinal and final inspections and/or meeting. Prior to scheduling the prefinal and final inspections, the Respondents shall send a letter to the Agencies stating that construction is substantially complete (prior to the prefinal inspection) and complete (for the final inspection) including completion of/ responding to any outstanding issues or punch-list items that were raised or identified by the Agencies during the prefinal inspection/meeting.

2.7 Removal Action Completion Report

Within 60 days after completion of construction of the Phase 1 removal actions, Respondents shall submit to the Agencies for review and approval a Removal Action Completion Report. This report shall contain a description of the work required in the TCRA Work Plan and/or design packages, and all approved deviations including nonconforming conditions and corrective actions. In the report, a professional engineer registered in the State of Idaho and the Respondents' project coordinator shall state that the TCRAs were constructed in accordance with the Final Design and the Final TCRA Work Plan. The written report shall include as-built drawings signed and stamped by a professional engineer registered in the State of Idaho, summary of data such as removal quantities and locations, analytical data collected in support of the Removal Action, an estimate of total costs for the TCRA, and any lessons learned. All analytical data collected under the ASAOC and SOW shall be provided electronically to the Agencies. The Removal Action Completion Report shall contain a description of any institutional controls that are in place, or engineering controls that are necessary to sustain the integrity of the Removal Action, along with copies of any agreements or other documents used to establish and implement such controls.

The final report shall also include the following certification signed by a person who supervised or directed the preparation of the report:

"Under penalty of perjury under the laws of the United States, I certify that to the best of my knowledge, after appropriate inquiries of all relevant persons involved in the preparation of the report, the information submitted is true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of imprisonment."

2.8 Post-Removal Site Control

Post-Removal Site Control shall include actions necessary to ensure the effectiveness and integrity of the removal action to be performed pursuant to this Settlement consistent with Sections 300.415(I) and 300.5 of the NCP and "Policy on Management of Post-Removal Site Control" (OSWER Directive No. 9360.2-02, Dec. 3, 1990).

Respondents shall submit a plan for Post-Removal Site Control activities which shall include, but not be limited to: water diversion around NW Bradley Dumps/Hennessy Creek, Smelter Flats/Hangar Flats, and the DMEA Waste Rock Dump, removal of 500,000 tons of Waste Material from streambanks and floodplain areas, and the on-site repository for long-term containment of the excavated Waste Material. Upon Agency approval, Respondents shall either conduct Post-Removal Site Control activities, or obtain a written commitment from another party to conduct such activities, until such time as the Agencies determine that no further Post-Removal Site Control is necessary. Respondents shall provide the Agencies with documentation of all Post-Removal Site Control commitments.

2.9 Community Involvement Activities

Respondents shall provide information supporting community involvement programs related to the activities performed pursuant to this ASAOC and SOW and shall participate in public meetings upon the request of the Agencies. The public meetings may be held or sponsored by the Agencies to explain activities at the Removal Action Area or concerning Work performed pursuant to this ASAOC and SOW.

3.0 TCRA Optional Bridge Phase between Phase 1 and Phase 2 (ASAOC Year 5/2025)

After completion of all Work in Phase 1, if the approvals, authorizations, and permits have not been obtained for mine operations at the Site, Respondents may elect to perform activities in the optional Bridge Phase. Respondents must notify the Agencies in writing within thirty (30) days of issuance by the Agencies of a Notification of Completion of Phase 1 that they agree to perform the activities under the Bridge Phase. If the Agencies agree to Respondents' performance of the Bridge Phase, Respondents shall remove 200,000 additional tons of Waste Material (including waste/sediment) from streambank and floodplain areas and placement of these Waste Materials in an on-site repository. The Waste Materials may be placed in the same repository(s) as the 300,000 tons of Waste Material removed under Phase 1, if determined to be feasible by the Agencies and the Respondents.

Optional Bridge Phase Tasks are described below.

3.1 Additional Waste Material Removal

If, at the end of Phase 1, Respondents are still working to secure an approved mine plan and/or permits, Respondents may elect to perform the activities in the Bridge Phase. Respondents shall complete the optional Bridge Phase within one year of the date that the Agencies respond to the draft Time Critical Removal Action Work Plan for the Bridge Phase submitted by the Respondents. The activities to be performed during the optional Bridge Phase include removal and disposal of 200,000 additional tons of Waste Material from streambank and floodplain in the following Source Areas, in the following order of priority: the Keyway Dam and the Marsh Area, the Bradley Man Camp Dumps, the Bradley NE Oxide Dumps, the BMC Northwest Bradley Waste Rock Dumps and areas adjacent to and SW of the Yellow Pine Pit, or other Source Areas as appropriate. The removal objectives, planning documents, performance goals, and tasks are the same as those required for the Phase 1 Waste Material removal project, except for those tasks already completed in Phase 1 (for example, the Waste/Sediment Removal Action TCRA Work Plan prepared in Phase 1 will include the 200,000 tons of Waste Material scheduled for removal during the optional Bridge Phase, so a Waste/Sediment Removal TCRA Work Plan is not required in the optional Bridge Phase).

3.2 Post-Removal Site Control

Respondents shall continue to implement Post-Removal Site Control activities for all completed and ongoing removal actions during the Optional Bridge Phase. Respondents shall either conduct Post-Removal Site Control activities or obtain a written commitment from another party to conduct such activities, until such time as the Agencies determine that no further Post-Removal Site Control is necessary. Respondents shall provide the Agencies with documentation of all Post-Removal Site Control commitments.

4.0 Non-Time Critical Removal Actions

Two NTCRAs are described below as Optional Phase 2 and Optional Phase 3. NTCRAs shall be implemented in accordance with EPA's, *Guidance on Conducting Non-Time-Critical Removal Actions Under CERCLA*. EPA 540-R-93-057.

4.1 Optional Phase 2 (ASAOC Years 5-8, or 6-9 if Bridge Phase selected/2025-2028 or 2026-2029)

If Respondents elect to perform Phase 2, Phase 2 Work shall begin after completion of Phase 1 or after completion of the optional Bridge Phase. Phase 2 Work shall only be performed by Respondents if Respondents have obtained an approved mine plan and permits and the Agencies agree to the performance of Phase 2 by Respondents. Phase 2 work includes the following:

- Develop a detailed Project Schedule for the Agencies' approval;
- Remove 200,000 additional tons of Waste Material from streambank and floodplain Source
 Areas, if not already implemented under the optional Bridge Phase; and
- Develop a draft and final EE/CA, which will include an evaluation of removal actions for each of
 the five adits identified as Source Areas in this SOW. The EE/CA prepared during optional Phase
 2 will build off the adit characterization TCRA performed during Phase 1 and incorporate the
 alternative evaluation documented in the RAA Report. Potential removal actions could include

collecting and treating MIW discharged from the adits, diverting clean upgradient water away from adit intake structures, constructing bulkheads, and installing passive treatment systems.

Implement an Action Memo (if one is issued by the Agencies) that is based on the EE/CA Report to address discharges of MIW at the five adits studied in Phase 1. An Action Memo will be based on the EE/CA Report prepared to address discharges of MIW at the five adits studied in Phase 1. The Respondents shall respond to and implement the Action Memo through the documents identified in Section 5.0, with removals complying with ARARs to the extent practicable and providing bases for any waivers in consultation with EPA, the USFS, and the State of Idaho.

OPTIONAL PHASE 2 TASKS

Removal of Waste Material from streambank and floodplain areas

If the optional Bridge Phase is not implemented, the first task under Phase 2 will be the removal of 200,000 additional tons of Waste Material from streambank and floodplain Source Areas, as described under optional Bridge Phase tasks, above.

Optional Additional Adit Investigation

During mining under an approved mine plan, dewatering the open pit mines could decrease discharge flows from many of the Site's adits. Dewatering may facilitate access and enable additional studies in one or more of the adits that could not be completed during normal flow conditions. If needed to support the selection and design of removal actions for the Bailey Tunnel, DMEA Adit, Bonanza Adit, Cinnabar Tunnel, or the Meadow Creek Adit, the Respondents may propose additional studies during Phase 2. These studies, which could include geotechnical and engineering investigations, should complement the baseline studies completed in Phase 1. If Respondents decide to collect additional data at the adits, they will prepare an EE/CA Work Plan for the Agencies' review and approval. Additional adit data collection must comply with EPA's memorandum on "Developing Consultation Packages for CERCLA Activities at Abandoned Hardrock Mining and Mineral Processing Sites in Preparation for the Fiscal Year 2017 Construction Season "or a future revised memo, if available. This memo assists the EPA regions in Fiscal Year planning for applicable CERCLA removal assessment, pre-remedial and remedial evaluation, investigation and response activities at hardrock mining and mineral processing sites with actual or potential fluid release hazards. The new EE/CA Work Plan shall incorporate by reference relevant portions of the approved TCRA Work Plan for Adits completed during Phase 1. The new EE/CA Work Plan shall also include:

- An updated Conceptual Site Model (CSM) for each adit. The updated CSM should explain how data collected during Phase 1 has informed changes to the CSM.
- Identification of data gaps to be filled.
- A QAPP detailing the procedures the Respondents plan to implement when conducting all field activities. Attachment 3 identifies guidance for preparation of a QAPP.
- A Job Hazard Analysis identifying the specific tasks workers will undertake during the additional adit investigations, and a HASP Amendment, if needed, to ensure the safety of workers implementing the field activities.

When the results of the additional investigations are available, Respondents shall present the additional data in an EE/CA report(s) that includes a newly updated CSM for the adits.

EE/CA for Adit Seeps

In optional Phase 2, Respondents shall prepare an EE/CA report for the five adits studied in Phase 1. The EE/CA shall evaluate and recommend potential remedial technologies consistent with EPA's 2017 guidance document entitled "Best Practices for Preventing Sudden, Uncontrolled Fluid Mining Waste Releases," OLEM Directive #9200.3-118, to address the adit seeps (e.g., installing bulkheads, diverting water away from adit intake structures, demolishing adit structures). The report shall discuss when in the planned sequence of mining activities construction would be most feasible. The EE/CA report will follow EPA's guidance document entitled "Guidance for Conducting Non-Time-Critical Removal Actions Under CERCLA," Office of Emergency and Remedial Response, EPA/540/R-93/057. For any recommended removal actions that require regular or continuous operations and maintenance (for example, passive or active water treatment), the report shall provide an estimate of annual operations costs. Additional documents required to complement and implement the EE/CA report are listed in the "Work Approach and Key Deliverables for all NTCRA Tasks" section of this SOW.

Implement Removal Action for Adit Seeps

In optional Phase 2, Respondents shall implement removal actions for the five adits recommended by the EE/CA and agreed upon by the EPA and USFS. Implementation of agreed-upon adit removal actions will follow steps 4-10 of Section 5.0 (Work Approach and Key Deliverables for all NTRA Tasks). Adit removals shall take into account any impacts mining may have on future adit discharge volume and chemistry.

Post-Removal Site Control

Respondents shall continue to implement Post-Removal Site Control activities for all completed Phase 1 and completed optional Bridge Phase removal actions, as well as for all completed removal actions during Phase 2.

The Agencies will amend the SOW for optional Phase 2 to address the details of Optional Phase 2 Work after Respondents have notified the Agencies in writing of their commitment to perform optional Phase 2. The amended SOW will include further definition of:

- I. Project Planning and Support,
- II. Removal Designs/Removal Actions, and
- III. Schedule of Deliverables.
- IV. Post-Removal Site Controls

If the Respondents elect to conduct Work under Phase 2, they shall submit a proposal for Post-Removal Site Control that addresses all Post-Removal Site Control work required in Phase 1, the Bridge Phase, and Phase 2. Upon Agency approval, Respondents shall either conduct Post-Removal Site Control activities, or obtain a written commitment from another party to conduct such activities, until such time as the Agencies determines that no further Post-Removal Site Control is necessary. Respondents shall provide the Agencies with documentation of all Post-Removal Site Control commitments.

4.2 Optional Phase 3 (ASAOC Years 9-20 or 10-20 / 2029 or 2030 - 2040)

Within thirty days of written notification by Respondents that they commit to perform the optional Phase 3 and agreement by the Agencies to continue with optional Phase 3, Respondents will develop and implement removal action work plans to address Waste Material remaining at the Site in Source Areas that are not covered by an approved mine plan or CWA permits, or other regulatory programs including earlier phases of this ASAOC.

During the optional Phase 3, Respondents will identify areas for implementation of removal actions and implement those actions in accordance with an Action Memo that may be issued by the Agencies to address releases of hazardous substances in areas that are not included in Phase 1, optional Bridge Phase, optional Phase 2, an approved mine plan, or permits. Respondents actions for Phase 3 shall include:

- Develop a detailed Project Schedule for the Agencies' approval.
- As necessary, conduct a supplemental Data Gaps Analysis to identify characterization needs that would inform an optimization of the overall remedy.
- Submit an Optimization Report proposing areas for implementation of further response actions.
- Develop an EE/CA for any actions not covered or completed under Phase 1 or 2, or an approved mine plan, or a Clean Water Act Permit which are needed to address remaining Waste Material.
- Implement any response actions selected by the Agencies in an Action Memo (if one is issued by the Agencies).

OPTIONAL PHASE 3 TASKS

If Respondents elect to perform Phase 3, Phase 3 Work shall begin after completion of Phase 2 work. Phase 3 Work shall only be performed by Respondents if the Agencies agree to the performance of Phase 3 by Respondents. If Respondents and the Agencies elect to continue work under the ASAOC in Phase 3, the Agencies will amend this SOW to identify the specific Source Areas to be addressed and the tasks to be performed. The Agencies will consider, where appropriate, the approved mine plan and mine operations and sequencing when approving the schedule for work in Phase 3. Areas and actions that could be addressed in Phase 3 include:

- Necessary upgrades to the water diversion projects at the NW Bradley Dumps / Hennessy Creek, the DMEA Waste Rock Dump, and the Smelter Flats / Hangar Flats. Replacement of the water diversion projects with more permanent and durable remedies (e.g. removal or capping of Source Areas), if the water diversion systems are difficult or costly to maintain;
- Construction and/or ongoing maintenance of final, permanent actions to address any of the Adit seeps in Phase 2 where interim removal actions were installed;
- Response actions to address Waste Material in the remaining portions of, Bradley Man Camp Dumps, the Bradley NE Oxide Dumps, the BMC Northwest Bradley Waste Rock Dumps and areas adjacent to, and SW of the Yellow Pine Pit;
- Response actions to address Waste Material in other Source Areas within Figure 1; and
- Source Areas within Figure 1 that were not previously known and were identified during ASAOC or mining activities.

Post-Removal Site Control

Respondents shall continue to implement Post-Removal Site Control activities associated with previous phases of Work under this ASAOC and shall implement Post-Removal Site Control activities for Work conducted under Phase 3.

If Respondents elect to perform Phase 3, and the Agencies agree to the performance of Phase 3 by Respondents, the agencies will amend this SOW set forth the Work to be performed in Phase 3. The amended SOW update will further define:

- Project Planning and Support;
- II. Removal Designs / Removal Actions;
- III. Schedule of Deliverables; and
- IV. Post-Removal Site Control.

Respondents shall provide all of the documentation associated with implementing these tasks as outlined above in optional Phase 2. If Respondents elect to conduct work under Phase 3, they shall submit a proposal for Post-Removal Site Control. Upon Agency approval, Respondents shall either conduct Post-Removal Site Control activities, or obtain a written commitment from another party to conduct such activities, until such time as the Agencies determine that no further Post-Removal Site Control is necessary. Respondents shall provide the Agencies with documentation of all Post-Removal Site Control commitments.

5.0 WORK APPROACH AND KEY DELIVERABLES FOR ALL NTCRA TASKS

Deliverables specified in this SOW shall be consistent with the NCP and appropriate EPA policy and guidance including "EPA's Guidance on Conducting Non-Time Critical Removal Actions under CERCLA" (EPA/540/R-93/057, OSWER 9360.0-32). illustrates requirements for documents and records generated during the NTCRA process that are to be included in the Administrative Record for the Site. Except where noted below, removal actions shall include preparation, delivery, and implementation of the following:

- 1. Engineering Evaluation/Cost Analysis (EE/CA) Work Plan including a Sampling and Analysis Plan (QAPP) (draft and final)
- 2. Removal Action Area Characterization Report (draft and final)
- 3. EE/CA Report (draft and final)
- 4. Biological Assessment (BA), Clean Water Act (CWA) Section 404 Evaluation, and Cultural Resources Survey
- 5. Removal Action Design Documents
- 6. Removal Action Work Plan
- 7. Implementation of Removal Actions
- 8. Removal Action Completion Report
- 9. Progress Reports
- 10. Post-Removal Site Control

Attachments

Table 1 - ASAOC Phases

Table 2 - Schedule for Phase 1 Tasks

Figure 1 – Map of the Stibnite Mine Site

Attachment 1 – Stibnite Site Source Areas

Attachment 2 – Scribe Data Element Dictionary

Attachment 3 – Regulations and Guidance Documents

Table 1 – ASAOC Phases

Table 1 lists the ASAOC phases and years, along with calendar years and the mining activities anticipated during each phase

ASAOC Phase	AOC Years	Calendar years	Mining Schedule under PRO
1	1 - 4	2020 - 2024	Mine permitting & construction
			(if approvals & permits received)
Bridge	5	2025	Bridge phase if permits are not received
			by end of Phase 1
2	Receipt of mine	2025 to 2028	Mine construction,
	permits & approvals	or	mine operations
	through mine year 4	2026 to 2029	
3	Mine operations	2029/2030	Mine operations and reclamation
	year 5 through	to 2040	
	mine reclamation		


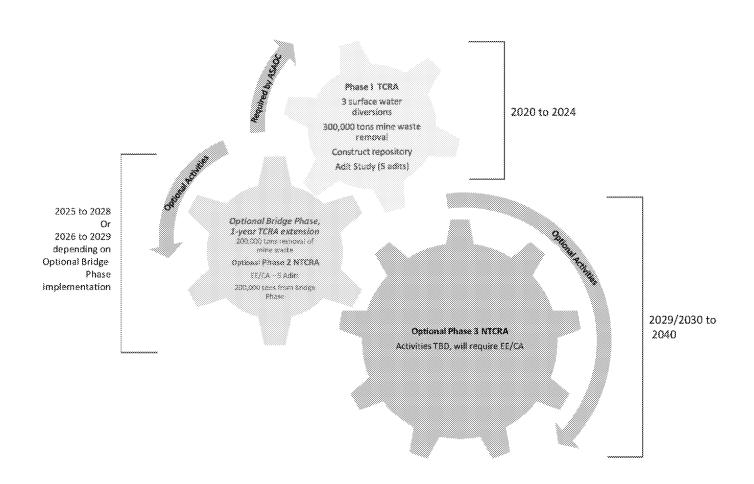


Table 2 – Schedule for Phase 1 Tasks

NOTE: The Respondents shall prepare a detailed schedule for review and approval by the Agencies.

Task or Deliverable	Schedule				
Site Characterization Report and Data Gaps	Fall 2020				
Analysis					
Health and Safety Plan(s)	Prior to implementation of field work and/or construction activities				
Interim Water Diversion Removal Action	Completed within 18 months of ASAOC unless schedule extended by Agencies				
TCRA Work Plan, draft and final Design Documents, draft and final 30% and 60% Design Package Draft final and final 100% Design	Winter 2020 Spring 2021				
Package and response to comments Removal Action Construction Removal Action Construction Completion Report, draft and final Post Removal Site Control, draft, draft final, and final	Summer/Fall 2021 Winter 2021 Winter 2021				
Waste/Sediment Removal and On-Site Repository Project	Completed within 30 months of ASAOC unless schedule extended by Agencies				
Removal Action Area Characterization Report, draft and final	Spring 2021				
TCRA Work Plan, draft and final	Winter2021				
 Design Documents, draft and final 30% Conceptual Design 60% Design Package Draft final and final 100% Design Package and response to comments 	Spring 2021/2022				
Removal Action Construction Removal Action Construction Completion	Fall 2023				
Report, draft and final Post Removal Site Control, draft, draft final, and final	Fall 2023				
Investigation of Baseline Conditions at Adits	Completed within 3 years of ASAOC unless schedule extended by Agencies				
TCRA Work Plan, draft, draft final, and final	Summer 2021				

Task or Deliverable	Schedule				
Adit Characterization Adit Removal Action Area	Fall/Winter 2021				
Characterization Report, draft, draft final, and final Removal Action Alternatives Report, draft, draft final, and final Preliminary Adit RA Implementation Plans & Schedule	Spring 2022 Summer 2023				
Data Validation Summaries	30 days after validation of data collected for each sampling event				
Quarterly Progress Reports	15 days after end of previous calendar quarter				

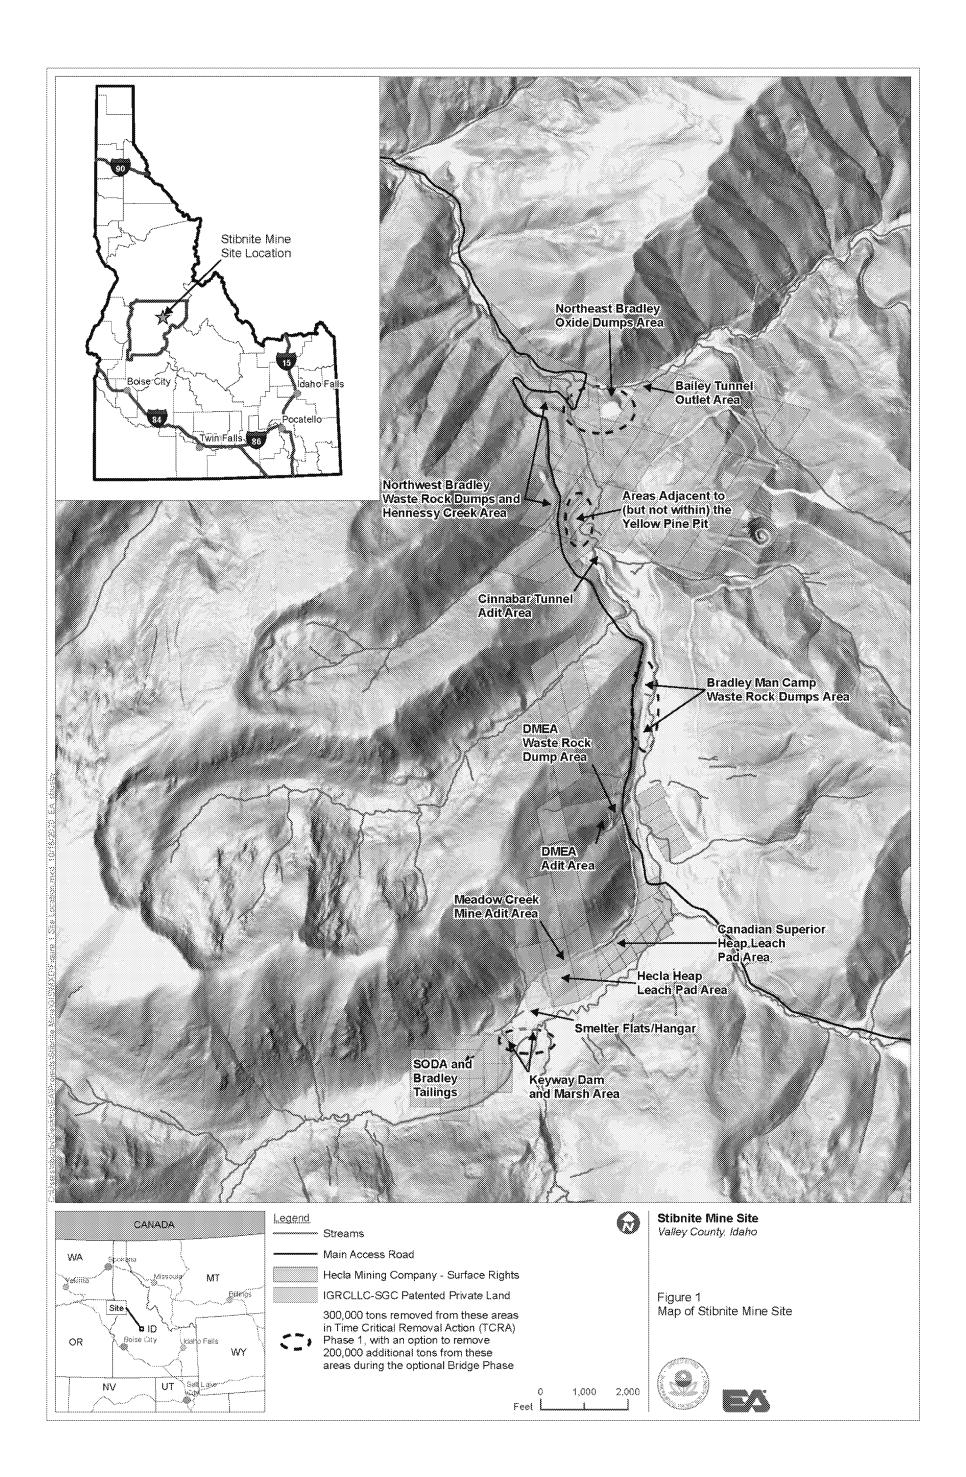

ATTACHMENT 1—Stibnite Site Source Areas

The following table lists Source Areas at the Stibnite Mine site that are candidates for removal actions under the SOW with their estimated annual arsenic loading.

Source ¹	Land Status	~ Arsenic loading (lb/year) ²
NW Bradley Dumps / Hennessy Creek	Mixed	86
Smelter Flats / Hangar Flats ³	Patented	59
DMEA Waste Rock Dump, Adit and Shaft	Unpatented	9
Bailey Tunnel	Patented MY - Outside of disturbance	23
Cinnabar Tunnel	Unpatented	21
Bonanza Adit	Unpatented	Note: The primary loading concern at this location and Sugar Creek is Mercury. This adit contributes approximately 0.5% of Hg loading to SC.
Bonanza Dump	Unpatented	Loading for this feature has not been determined.
Keyway Dam and Marsh Area	Mixed	29
Bradley Man Camp Dumps	Unpatented	20
Bradley NE Oxide Dumps	Mixed	8
Meadow Creek Adit Seep	Patented	6
Areas adjacent to and NE of the Yellow Pine Pit, including Monday Camp, Monday Camp Waste Rock Dump, and SE Bradley Waste Rock Dump	Mixed	Loading has not been determined.
Areas adjacent to and SW of the Yellow Pine Pit, and the BMC NW Bradley Waste Rock Dump	Mixed	Loading has not been determined.

Footnotes:

- 1. Estimates of arsenic loading from SRK, 2017, Existing Conditions Site-Wide Water Chemistry (SWWC) Memo, November 22, 2017 memo to Piper Goessel, USFS, p. 46.
- 2. One source of Bailey Tunnel is Yellow Pine Pit. Tunnel could continue to flow after completion of PRO due to connection to backfilled YPP unless bulkheading/closure is completed.
- 3. Also known as the Bradley Mill and Smelter and the Meadow Creek Mill and Smelter.

ATTACHMENT 2 – Scribe Data Element Dictionary

Region 10 Data Element Dictionary and Example Electronic Data Deliverables

- This document is meant to serve as a guide to assist Region 10 Superfund data providers who are responsible for submitting project and monitoring location information for archive to Scribe.net.
- It can serve as a preliminary guide to assist data providers who are in the process of planning data collection activities and need to determine the necessary data elements for their projects.
- The data elements in this file represent a complete list of the data types used by all the EPA Regions and are produced in CLP Electronic Data Deliverables. Many of these data fields are not used by Region 10 and are labeled as "Not Applicable" or "NA".
- Required data elements are clearly labelled and represent the minimum amount of information needed to represent lab results and to describe the sample disposition in terms of location, date/time of sample collection, matrix types, etc.
- The layout of this data element dictionary is to facilitate corrections to information submitted by field personnel (through COC XML resubmittals) and/or to upload lab data back into the Scribe Lab Results Table.

Questions should be submitted to Don Matheny (matheny.don@epa.gov) or Meghan Dunn (dunn.meghan@epa.gov).

The Data Element Dictionary (next tab) contains the following information.

Data Element Field Names

EDD Type - identifies the association of the data element as either a "Lab Result" or as "Sample" related information.

Required, Optional, Conditional, Not Applicable (R/O/C/NA) - Identifies the data element as required, etc. The details for some conditional data elements may be found in the description column.

Description or Preferred Values - General description of the data element, where the values are derived and possible values.

Field Format/Length - Identifies the data element format type and field length.

Origin - Identifies the origin of the data element. Some elements are "pass through" fields originating from Scribe or lab scheduling (i.e., RSCC). Otherwise these may be generated by the lab or during validation.

Scribe Table.DataFieldName - Name of the corresponding Scribe Table and Data Field Name(s) for that data element. A data element may correspond to more than one Scribe data field.

COC XML Field Name - Name of the corresponding XML tag for that data element. Required for elements that originate from Scribe.

EDD Data Element Updated w/resubmittal of COC XML? - (Y or N) Identifies if the data element may be updated through a COC XML that is resubmitted at a later time after samples have arrived at the lab.



Data Element Field Names	EEC Type	Required, Cythonal, Escubbarral, Net Applicable (8/0/C/NA)	Origin	Section Table Date FieldNesse	COX XXVI. Field Name	EDD Cata Element Updated w/resultanistal of EDC XMC?	Upload into Scribs fram EDD?	Cose manti
CASE_NUMBER	i als Resource	e	Scribe / Lab	COCCassRember	SteCogniumbo	ų.	а	in Sonbe this is found in the "COC (Sookkumber" and "Site Cossiliumber" halds. In the sont file it is this Site Cossiliumber are demand. There's no place for this in the Sonbe Labifeaults Tables.
svorus_cauvav_cacoup	Lab Results	c	Lace	ian Kasadoo Lang (Sanch (So		8	Ý	disonerated by the Lab.
SARRIE_ID	Lab Results	Ċ	196	Semples Tage CLP , Semp , No Las Beauth CLP , Semp , No	Sacorte Sacopleius	51	·	Chighnates in Scribe (nom-the "Semple:Tags C.F., Semple, No" field and is also uploaded into the "Sabilitation time, C.P., No" field: General of its John 1990.
CAS_RUMBER ANALYTE	Lab Results	*	1.80 1.80	Catt Pleasure Case (Alt) Lake Report to the Advisor		8	Ý	Generated by the Lab.
ENAL RESULT	Lab Results	R.	Lab / Cata Residence	Lastifest its Resear		11	¥	Conversited by the Let S. venified by Data Renavier. May be actived in EDRA whereas the Last, Result from before cannot be extred ourning data vacabation. The firms, Result had to
RESULT_UNITS	Lab Results	¥	1.85	Lacches des Aesalt, Units		N	٧	man-datury for MCL and other (auth contracted, government, etc. Habs. Generated by the Lab.
EIWAL VALIDATION DELAUFIER	tak Sasuks	R	EDM / Date Resisence	Late Report to Proced _ Countries		×	y.	Generalish by the EDM or Data Ramaxie
data_val_laber	Lab Romato	F	EDM / Data Raviower	los Assortic CA_Coursers		8	Y	Conversited by the EDM or Data Reviewer. This Scribe LackScoults Fairs with utilize the IDA Comment, hold in order to accommodular this official data alament.
SAMPLE_SERVERS_CEQL	tak Results	R	iae	LakeResults Chromatation Limit		N		Sprowrated by the Lab
sarple_adilisted_res.	Lab Results	÷	1,85	(anRealitis MCA		8	Ý	Generalised by the Lab
lab_result	Lab Respons		ise			ų.	а	There's no data hald for this in the Scottle Labilites for Table. The "Findig Result" data element which puspes validation has been written by optionally district the Scottle Table results Labine.
LAB_QUALIFIERS	Lab Reports		1.80	டல் 9 வெள்ள (விறிவை நிறுவிய		ħ	*	September by the Lub
METHOD_CROL	Lab Francis		1.80	Cathanita Reporting Laces		*	*	Successfully the Lab.
CREEK_LERWITS	Lab Resolts		Lab	Labbesults (Learning on Learn), thes Labbesults Popularing Learn), that i		N	¥	Elemps at ad by the Lab. The Countrication and Reporting Linux discardens entoring we in approxima Chara List the twent unit of evaluation and countries and relationship to the uploaded both two collections.
NGCL_UNRTS	tak Basuars	a.	Lan	Labbersata MEL Limits		N	Y	Generated by the Late.
PERCENT_SQUES	Lab Rossista	3	.85	Lakkesute Person Solids		*	Ý	General by the Lab
DERCEMT_MONSTURE	Lak Results	R	Late	Law Rosest Chercoms Johnson		N		Generated by the Lab
DRUTTON, FACTOR ANALYSIS, FRACTION	Lab Rossita	8	196	JahAesaks Cobesov, Factor		*	Y	Generated by the lab
WHAT ARE TENET	Lab Resides		.86	Labilities des desdesses		- N	, a	reserve rates by the Lab. There's new date has differ thes in the Scribe Lab Results Table.
REPORTING_BASES	sk insufr	R	Lan	Labites, Asiliasis		N.	1	signorgraphed by the Lab.
SAMPLE_CATE_TIME	Samples		Serise	Samples Sampledate Lai Assid's Code (Caberded	Location SampleCore Location Carcele Time	9	v	Originates on Rentite but is not and worther in CDC (ANI), readenature. This is issue to the ability to est; this arisomation in EDM stating data validation. To allow overwrite we CDC (ANI), resultatistic would include a business rule agreems dust overwrite input platforwire and intenduce.
								are violenterability to the system. Sample Date & Time are concatenated from two Sorbe CDC white fields. Therefore data field for this in the Sotton Catherina to Table and it obtains appears in the CDC.
DATE_SHIPPED	Sarapies	8	Sortice	COCDut ethiopied	Tricks (Substitute poet	· ·	N N	Tables
DATE_TRRE_RECEIVED	Samples	£	iæ:	LatePeach's Code_People and		N	v	Denierated by the Lati. Need to aboutle check this detections fields in the Labitesuits Table. The Sordier Table Dett. file shows the lengthal triase fields to be "3" but we need then to be "20".
PRES_DATE_TRAK	Lak Pesurs	8	Late	Labileadra Date Entracted		ų.	7	George stand by time Lab.
ANALYSIS DATE TRAE	Lab Results	8	i per	LabResuks Care, Angelicas		N		Elementated by the Lati. Generalized by the Lati. This ideas type cases Lab DC rung connec (e.g.,
LAB_SABARE_TYPE	tak Sesses	R	ise	LabFess#sCS_Type		ų.	Ŷ	"Labourance, Clock of Justicinia and diselective reaches the data defination of the OC Types data fitted. The previously identified fuelting Type, Clock was only 30 characters long.
	Lab Results	8	Las	cabifessite.Macris (O		N	,	Generated by the job. OF has this defeathors but flowed ables need to match up with the Lamples Matrix Lorder data field? I thought those were populated appearance. Generated by the Lab. For the OUT this was concessed from the Form I command freights.
RESULT_COMMENT LAB_MAKE	Lap Passuris Samples	1	1.80 L90	Lab Residts Comments		N N	Ý	provide information, such as sins fraction. Generated by the Lish
EAB_CODE	Samples		Lao			e.	я	Thereof a nor alor of held for should the Schole Capitherathe Table.
COMPRACT_RUMBER	Samples		1,96			N	N	There's no uses held for this orthe York be Labile auto Table.
METHOD_NURSES_OR_CLF_SOW RAGNALIA_RAGN	Lab Results	ł.	Lab Lab	Labit esoit s. Amelytical (Mattine)			Y	Supremotion by the Lab. There's no claim legis for this in the Sorthe Lab Results Table.
TR_COC_NUMBER	Samples	ř	Sarribas	Sangdestags COC LateRescha Late_Coc_Poc	Accelysic TRAce	1	, , , , , , , , , , , , , , , , , , ,	General set to the a registron tras of trace sommer. Leadings of the set to t
CI_339882_BAJ	Sarapies	Ę	Lati	LikeResoft of Maria (No		N	ч	Generated by the Late.
LAB_FILE_ID	Leb Resorts	d	1,89				N	Thereo's no digrathed for thesion the Sunfae Late Associal Table.
INSTRUMENT_ID SAMPLE_ALIQUOT	Lab Results	F	(.ac)	tabenate intransis_Amoun		N N	N Y	There's no distained for this or the Sorthe LabiResults Table. Generalist by the Lab
SAMPLE_ALIQUOT_UNETS	tak Resums	R	Lakt	Casif South Southways & Amount John		ų		Generalization (the Lab.
FIRM_VOLUME	Lab Residus		(4)	ial@esitsimal_valume		51	·	Generalise by the Lab
ENVE ACTIVATE THEIR	tak Pesyats	4	1.00	alinkeed to final proteine, Unit		ų	¥	Generated by the Lab. There's no data field for this in the Solike Labkasolins Table. The analysis requires the use of ten
SOIL_EXTRACT_VOLUME SOIL_EXTRACT_VOLUME_UNITS	Lair Resorts	6	Las Las			8	ri ti	m any fields (e.g., finel volume is already filleds. There is no desofield for this in the Scribe CabiPassits Facia. The wholve's requires the use of too.
SOIL_EKTRACT_VOLUME_UMPS	Lag Security		L .*					is any fields (e.g., final votime is enemal) (1944)

SOIL_ALIQUOT_VOLUME	Lair Results C	Lee			N	м	There's no data field for this in the Sonhe LabResults Talte. The enables exquire to the use of the many fields (e.g., final volumes is stready filled).
SOIL_ALIQUOT_VOLUME_UNITS	Lak Results C	Les			Ŋ	14	There's nin desafted for this in the Conscitutification Table. The analysis returnes the use of too many holds (e.g., final volumes codress), titled)
PURSE_VOLUME	Lati Papulto C	139	calification (volume		8	У	Garnerared by the Lab
PURGE_VOLUME_UMETS	Lak Results C	1,00	udsAssaltuFind_valums_Um		N	Y	clamarated by the Lab.
SPIKE_ADDED	Lais Reputts C	1.89			ħ	N	There's no distributed for thesion the Cordee LabeRoscillo Takelo.
CONCENTRATED_EXTRACT_VOLUME	Lab Septine C	Lase			N	Ŋ	There's no data field for the in the Scribe Latiflescite Table. The enalysis regimes the use of cou- orans Rolds (e.g., final volume is already filled).
OTHER SMULLON, TOARTICE, DETARTHEEMED	Lab Resolute C	1.90			8:	м	There's critic district field if for time in the Sonitive Labracoth's Labra. The analysis recipies at the use of Loo many feedby (e.g., final problems is advance) filters.
RESCRICKS, VOLUME	Lab Security C	Lab			N.	и	Theore's nord at a feel of for this in stop Socious Labilities. It is Tablie
HARETHON VICTORIE THREE	Lab Results C	ist.			8:	и	There's in distributed for this in the Confee Lab Reside Table.
PREPARATION_METHOD	Ladi Resolato - F	Cate	LabResults for a time_Medical		n	¥	Genteror and try thre Lock
SPC_CLEANUP	Lak Results C	Lab			Ŋ	9	Theore's no distriction of the first of the single-stress to the Scotter Lab Hersutz a Tablic
GPT_FACTOR	Lab Results C	195			N	N	There's no years field for the in the liceller lab Resido Takin.
DECAMIED	cate Process	Lan			8	ig .	Three efector of state field for the sun the Sordae Celeffersuits Yalide.
жн	Lab Results C	1.95			5;	N	There's no date feeled for this in the Scribe Labbership Table.
COOLER_TEMP	Samples R	Lac			N	а	There's no disestial distribution the Scotter Lacillessifts Table
SAMPLE FRACTION	Lab Results C	Sense	Leb Result's Total Cir (Dissolved		N	4	Generalized by the Lab
METHOD_SPECIATION	Lab Passifts C	1,80			ti.	а	General ed by the Lab. Thereis no data field for this in the bride LabResids Fable.
SAMPLE_SUBMATRIX	iwapier f	Surribus	Samples Matrix	Consistent Albannis		ē)	Administry in Service. The priorie for is as this Service calciforcitis Tables.
Sampung_Reason	Catagonia P	Sorte	Stelle julius	Step Action	110	8	Alteredy in Scribe. No place for it is the Scribe CalcResidts Tables.
SAMPLE_COLLECTION_METHOD	Samples E	\$100	Samples Sample Addisorter	Location Compositivate	Ÿ	ų	Arroady in Sortial Pits plants for it at the Sortial Cabilles of State
EPA_RESION	Campion 5	Series	Cha SPANogranitransor	Star Et Wagon burston	80	N	Altracely in Scribe. No plane for it or the Scriber Lab Resolts Takin.
STATION_LOCATION	i despres	Sonbe	Exception Extraplicy	Station Station Nation	ħ	N	Congresses in Sortice four remot over-vertice in OCOMM, representates. This is due to the abolity to sold this information in 1925 discing facts a condition. If allow entercritic in a CCOM, resultanditia, would violate a faustrictor vide aggests duel over-virte insult professives and storod use.
LOCATION_DESCRIPTION	Sample F	Santo	Local for Local to Cesosphion	Leave on Leave or Creamps on	7	N	an volverability to the system Alterially in Serbie. Ner place for it as the Serbie LabRosoft's Table.
SCRIBE_EARAPLE_PAINTRESS	Sample: E	3,000	Semples Seep No LebRosuks Seep No	construction plantage	Y O	¥ in the	Congrades in Sentes in the "Leopies Laws, En" held that is size opticeded into the Set Results Sample, CP John held:
180e1004_0048	sangkes F	Sorte	Lecation Location Sone	Lacation Lacation Come	*	8	Altready in Scribe. Nei place for it is the Scribe LabiReadits 7 Male.
ATTUE	Samples A	knoe	Lecation satitude	10180011876488		34	Alarquady, in Stations. The palipties for the Station EndoRelaydes Stabile
LENGTUDS	Savagues A	Scribe	Lead of an Lange Lake	Countries Conglisidat	¥	ч	Missandy in Scotting. This prince force in the Scottin Lab Results Yabile
Set He	Samples A	Sente	Last Wilder Descript	Les et on Decur	Ý	N	Abready in Scribes. The priese for it is the Sorbe Labiliesulis Table
GEOMETHIS	complex A	Soribe	Education Geol/Archod	specifican specificant destroy	Y	N	Afresdy in Scribe. Neighbor for in in the Scribe LakiResults Takie.
SURFACE SECURISES	Semples C	Service	Location Suff Ben	Location Surface(Stevation	¥	a	Almondy in Symbol, the primer has deen than Sombon Labilities des Labilie
		Ser. 10		20.00	,	9	
SUPPACE ELEVATION UNITS	Complete C		Location Set Units	un ann beitadha deomhain		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	witnesdy in Semble. No pisote for mor this Scrible Labi Pare III's Tables.
	Samples C	Sortice	Cassian Electricities Location Electricature	Location SurfaceSecationMethod Location SurfaceSecationDeticn	,	4	Alteredy in Scribe. Nex plans for it or the Scribe Lab Passuka Sabra. Alteredy in Scribe. Not proce for a in the Scribe Lab Passuka Sabra.
rue como	Samples C	Sense	Samples Samp Cepth	Longreen Depok	1	N	Almostiv in Schibe. No prisms for a or the Schibe Labhacutis Sable.
SOTION SOFTS	Sespies C	Sorbe	propressions (reprinte	Lordon Deposto	ŕ	ч	ediready in Sonose. Hos pilace for a zo tita Sordue Labifeeudite Yakha.
TOP DEPTH UNITS	Sergies C	Sense	Samples Semp, Depth Units	Location Carobilism	Y	И	Almondy in Sorther. Not plants for it so the Sorthe Ladi Merutus Labra.
SOTTEM OFFICIALTY	Sangies C	Sinte	Samples Samp Depth Lines	Lacation Depth Con	7	81	witnessady on Scroble. Non prisupe Roma on this Scribes Labilitiessades Yabile.
SARTER NAME	Sergies ii	Sente	Samples Samulas	(sicelis: Semple Name	Y	и	Altready in Society. No place for it is the Society Lab Resides I dole.
STREET CHEST CONTES	Samples F	Sonte	StarCROntess	Stat Projectionales		и	edrasely in Scribe. His place for it is the Strike wak Results Takles.
Particle Charges Print	Saraples ii	52,956	SHE CONFIGURE	Stestwooding.commany	N	и	Almostly in Strokke: 50s place for it at the Yordon Lub Resolts: Table.
MORET NAME	Samples F	RSCOVEDM	Site Site Joseph	Sites Site/Spin o	81	м	Almandy in Sorbia. No place for it in the Sinbe cabhesults Table. Ongri at a from the faboratory respect subscript during scheduling. Almandy in Sorbia. No place for it in the Sorbia Sakhaudis Table. Organization the balanceous
STE PROJECT CODE	Samples R	RSCC/EDIA	GX ProjectCode	Sites Project Code	Y	84	Amenage is Survive. The place for it in time Survive Used leading Table. Congradues time the following survive time. Also hand emanded onto CCC binning CCC generation and optionals to lab in SOC MAC.
BITE EXEMT IN	Supplies F	Sorriba	site Control (No	Stres.Event D	¥	N	Advasidy on Corbine. No observe for it is shallon backer abbreside Table. Advantly in Surface. No place for it is the Surface Labbresid's Table. Originates from the baboratory
STATE	Samples 4	#SCOSD##	State State	Strocklase	N	ч	processing in surface. The processing on the surface specimens classification configuration from the basic many services of the first surface specimens of the first surface specimens. Alternately in Stations: The glasse for it in the Sonion Labelshould in Table . Origin 4 as from the Sonion street
OTY CERCUS	Camples B	RSCQ80M State	Ste Assa	ALL COMPA	N N	N	request submitted during scheduring Airpody in Soritos, the place for a or the Soritos (ablesides Table
STIE 572 (03400)	Samples A Samples S	Sente	See CERCLIS See See Soc	Stas (IPQ)s Stas (IPPsychol	Y Y	N	Arregory in Sonther, this prime is that the Sonther Lab Resolution Labore Alteretry in Sonther, his primer for it on the Sonther Lab Resolution Labore
SPIRE NO PROJECT DO	Sample: S	2,956	State Surfreshing Jean (S	sites to tablethingsett		и	Minerally in Statibus. Pits plants for it at the Souther AbResolus Table
and the	Samples R	Scribe	Semples Tags Tag	Bothle Fagnia	4	N	Atmosphy in Spritce: Not prince for a or the Sorders Lab Resolve Table
COMMENT COMMENT	Sarapias S	Sonte Sonte	San ples Ran acks Sans les San plaType	Laudenn Cannolis (ann earts Sannylen Sannolief ype	Y	24 24	Afresofy in Scribe: No place for it is the Scribe Lab Resolts Salite. Afresofy in Series, 160 place for it in the Sorbe Lab Resolts Sable.
QC_SPRIKE_RCCOVERY	Lak Results F	Las	Labificación Percent Percent			Y	Otenseration by the Lab.

sor_auguar_values	al: Resource	c	Lab			e;	N	There's into diatra field for this in the Southe CanResolt's Fail's. The analysis requires this uso of the many fields (a.g., final volume is already filled).
SOL_ALIQUOT_VOLUMS_UNITS Lo	ak Results	Ç	Lec			×	14	There and data field for the in the Sortie Labileout & Table. The analysis requires the use of Lou- many York (e.g., frost volume is preschibiled).
eures_voures	ab Results	ç	ias	cabResotsEmai_voluma		*	Ý	Seneralised by the Lab.
BURGE_VOLUME_UMETS (3	ak Results	Ĉ	Late	Jakifeesits.Final_Valume_Uni		2	Y	Generated by the Lab.
SPING_ADDED 1.0	alo Respúto	c	1.80			N	N	Thoms's no alast field for thes in the Scoke LakeRasuiks Takin.
CONCENTRATED_EXTRACT_VOLUME (3	ak Resorts	č	(se			×	N	There's nie data field für the in tha Centre Lati-Results Table. The engines recoveres the use of the enerty fields (e.g., final volume is already littled).
CONCENTRATED_EXTRACT_VOLUME_LINITS	ab Reseits	¢.	i des			8:	N	There's true data field for tips in the Suntax satisface by Takta. The analysis requires the use of ten on any traditions, food only-se is already (Bend).
	ab Resource	C	Lace			8	н	Theore's no class field for that in this Sordan Lab Heruitis Table
NABETTION YELLAND UNITS 1.0	de Results	¢	isk			ě:	ч	Theore's one data a time of the for the purther Lordon Labelbeauths Todous.
PREPARATION_METHOD	di Resulto	Ř	iso	Labbeach (Ecoardon John Port		6	¥	General by the List
SPC_CLEANUP 13	ak Results	ē	Lair			S.	9	Theoretis not distall facilities in the Scotlans Labille Suits Teletie
GPC_FACTOR Lo	als Resolts	¢	isc			ħ;	N	There's no past of feets for the six the floothe LabReschis Table.
DECAMPLED 1.0	ab Ressure	e e	ise			8	а	These's no dista field for this in the Sorbie cabillesury Yabile
PH La	ab Results	Ç.	Les			N	м	There's no uses fiscal for this in the liceba Laskenicks Laskenicks
	Samples	R	Lab			S)	2)	There's not discolfished for this in the Sortise Laufilesolite Table
	ale Rassults	Ċ	Sente	Land Flat Land Co. Disserved		Ŋ	4	Connecrated by the Lab
METHOD_SPECIATION Lo	at Pessets	ξ.	Lab			Q	3	General edity the Lab. There's no discalled for this in the Lordon Lab Resolution lable.
SAMPLE_SUBMATRIX 5	Campios	Ř.	Service	(angus h) # m	Doscer Marie	****	8	Almosofy in Sentice. No place for it in the Sentile calificacity Tables.
SAMPUNG_REASON :	Samples	R	Seritor	Stelling Admin	StepArton	100	я	Alt anally in Scribe. No place for it in the Scribe cub-Results Takini
	Samples	8 (1)	Sotie	Semples Semple Collection	Sprakton Compissivaters	¥	¥	Almounds in Sonther. The princer for All of the Sonther Labitimeouth's Table
ea reson	Coenceloo	ē	Sortion	Cha SPASogian Number	Stee (PW) og enternor	8	14	Although its Contine - New place for it is not a black at all Records a Takine. Congruences in Sentine had a programmer work for in COCOMM, presidentificate. This is down to the abolity to
STATION_LOCATION :	. sets prints	ē	Sonto	Location Location	Station Station Name	N	N	soft this reformation in EDE during data ratifiation. To allow everyone via CCC OR, assumentate would include a business rule against 4-ad overhelds include perfuvely and notification an indirection to the DES.
LOCATION_DESCRIPTION	Sample	Ř	Sonte	Local on Local or Decorption	Locator Local in Deemprior	y e	ы	Altocally in Sentice. No prisons for it as the Sentice LabiRenolity Tables.
SCRIBE, SAMPLE, SAMPLES	Samples	8	kno	Samples See plots LebResuRis Serve 180	popularion, some following for	Y		Cingon aloss in Scribes in this "Screepies, Some, for "field find its also upinsested into the "Labitassita Somple, CLP, No" held.
101871014,3014	i angles	Ř	Swite	janahan ji nahan Sarie	Les attent Les attentione	¥	я	Alteredy in Scribe: No priore for it in the Scribe Lub/Results Table.
uman s	Samples	8	X1134	Lossion Latitude	LOUBLOO LARRIADES		ų	Abready in Sorthan 1905 piace for it it the Sorthan Lab Resolter Labile
us no Tutte	Samples	Ŕ	Sente	Cocation Longitude	Cocation Conglisions	¥	ч	Micropoly to Sonton. Bits proceed for at its time Sorther Lab President Table
Set 194	Samples	Ŗ	Sende	Secretary Decom	Local Cr. Datum	· ·	N.	Air saidy in Borton. 1815 phone for at at the Sordon Lab Presides Table
	i omples	Ř	Scribe	sasatian Geofferhoo	Location Location (Actino)	Y	N	Already in Senbe. Neuplace force in the Scribin LabiReadts Takla.
SIFFACE ELEVATION .	Samples	¢	Service	Constructive (Biss	Lacation SurfaceStates to co	٧	а	Altready in Souther. The prince for it in the Souther Lab Results Table
anter strengther	Samples	ę.	Sonbe	Location Stat Litera	proces interested and contacts	7	- 13	ainseafy in Senibe. No pison for non-the Sordine LabiRessito Tablia.
Carrier Screening Maries	Camples	4	Sente	Lacadan Fleefdethad	Locator SurfaceBenationAleaned	¥	и	Almandy in Scribe. We place for it is the torike Labika-suks Tablis.
SIRFACE PLEVISION DATUM	Samples	C.	Sonite	Location (See Catum	Lacation Sofored levels on Decem	Y	и	Allowardy in Sonton, New program for at in this Sondon's sub-Resource Yakile.
TOP COPTE TO	Earn piles	c	Service	Samples Samp (Seprin	Long con Depth	Y	и	Almostiv in Scribe. Also place for at as the Scribe LabReadto Fabrie.
SOTTOM CEPTH S	Samples	¢	Scribe	ceoples Sono (Lepth 11)	Lowenthemata	ŕ	ä	ed early in Sentoe. Per prise for a to the Scribe LabiResults Yabile.
TOP COTT. UNITS	Samples	¢	Sontie	Camples Seng, Cepth, Units	Lacesco Cesabilitar	¥	И	Althoughy in Scooler, Not plante for it in the Scotler Lab Results Eather
SOTTOM, GAPEN LIBERTS	Samples		Stribe	Sainteles Samp_Depth (Shab)	Location Depth Con	· ·	N	elinacity in Scribe. No place for it in the Scribe Labilities (Table
SAFEE BASE	Samples	P	seribe	Samples Samples	Location Sample/Same	×	И	Altready to Scribes. No plane for it or the Scribe Labilities do fee
SCHOOL CHOOL COTACT	Samples	R	Sanba	Sea-Ci Ricontain	Stat Projectionales	Ý	91	adragaty in Sentoe. Pas pracie for it in the Satisfie Lab Hessito Tables.
	Samples	11	Write	Sta Contractor	StesSendingCarpany	81	N	Already in Sorbe. No place for it is the Sorbe Labikeouts Labik. Already in Surbia. No place for it in the Sorbe Labikeouts Table. Origin axes from the laboratory
	Samples	R.	RSCO/EDM	Site Site Stance	Sities Starban e		9	request submitted during achieving. Afready in Santia. No place for it in the Santie Cashacids Tasha. Cargorates from the laboratory.
	Samples	a e	ASCC/EDIA Santas	COC Project Code Wes Compat (10)	Sites Project Cade Sites Eventio	,	e N	required automatical discring achievations. Also hand embre of entry CDC training CDC generals on and optionable to find in 1005 MPC. Advanced in Contine. No phase for in in this Condine cubinhouse to Takin.
	Samples	e e	ASCI/EDAA	SWe.Stre State	Mes Mass	, v	4	Africates in Surface. No place for it in the Surface LabPassills Table. Oughtsteelings the laborators
	: acupies	Ř	RSQUEDM	Sta Avya	7477	2	и	request salterative during attentioning Alternative Statistic Recipiese for it in the Sorder Labbeau As Table. Origin also from the laboratory requised submitted during collectioning.
	Samples	a.	Scribe	Sine CERCLIS	SANCTARDS	N	и	required submitters during establishing. Already in Sentee, the prace for it in the Sordina LabReputic Table.
CHIEF STE PERSON	Samples	ü	Sente	Scasza (ic	stag stellumbe	Ŷ	N	Almands in Scribe. No place for it is the Sorbie LabReautic Lable.
	Samples	e.	\$005¢	Sne Surbetter/reger#C	Stessor beforehopent	¥	и	Almosphy in Spirible. No priore for it in the Spriber LibeResides Fabric
	Samples Language	B C	Scribe Scribe	Namples Fags Fag Samples Romarks	Boths Fagino Location Campia Comments	Y	N	Acrosody in Sontiles. No place for it in the Sontine Lab Resolutio Table. Advanting to Contine: Not prove for it in the Sontine Lab Resolutio Tables.
-	Samples	a.	Sonte	Saruo les Sempre Froe	Saturples Sampled you	¥	4	Almandy in horbor. No place for it is the Sadhe Labilierodus Fable.
QC_SPAKE_RSCOVERY //	ak Results	В	Lec	LabResults Percent_Resuvery				Generated by the Lab.

ATTACHMENT 3 - Regulations and Guidance Documents

The following list, although not comprehensive, comprises many of the regulations and guidance documents that apply to the RD and RA process:

- 1. American National Standards Practices for Respiratory Protection. American National Standards Institute Z88.2-1980, March 11, 1981.
- 2. ARCS Construction Contract Modification Procedures September 89, OERR Directive 9355.5-01/FS.
- 3. CERCLA Compliance with Other Laws Manual, Two Volumes, U.S. EPA, Office of Emergency and Remedial Response, August 1988(DRAFT), OSWER Directive No. 9234.1-01 and -02.
- 4. Community Relations in Superfund A Handbook, U.S. EPA, Office of Emergency and Remedial Response, June 1988, OSWER Directive No. 9230.0-3B.
- 5. A Compendium of Superfund Field Operations Methods, Two Volumes, U.S. EPA, Office of Emergency and Remedial Response, EPA/540/P-87/001a, August 1987, OSWER Directive No. 9355.0-14.
- 6. Construction Quality Assurance for Hazardous Waste Land Disposal Facilities, U.S. EPA, Office of Solid Waste and Emergency Response, October 1986, OSWER Directive No. 9472.003.
- 7. Contractor Requirements for the Control and Security of RCRA Confidential Business Information, March 1984.
- 8. Data Quality Objectives for Remedial Response Activities, U.S. EPA, Office of Emergency and Remedial Response and Office of Waste Programs Enforcement, EPA/540/G-87/003, March 1987, OSWER Directive No. 9335.0-7B.
- 9. Engineering Support Branch Standard Operating Procedures and Quality Assurance Manual, U.S. EPA Region IV, Environmental Services Division, April 1, 1986 (revised periodically).
- 10. EPA NEIC Policies and Procedures Manual, EPA-330/9-78-001-R, May 1978, revised November 1984.
- 11. EPA Technical Guidance Document for Final Covers on Hazardous Waste Landfills and Surface Impoundments. July 1989.
- 12. EPA OSWER Directive 9355.7-01. Memorandum regarding Permits and Permit "Equivalency" Process for CERCLA On-site Response Actions. February 19, 1992.
- 13. Guidance on EPA Oversight of Remedial Designs and Remedial Actions Performed by Potential Responsible Parties, U.S. EPA Office of Emergency and Remedial Response, EPA/540/G-90/001, April 1990.
- 14. Guidance on Expediting Remedial Design and Remedial Actions, EPA/54O/G-90/006, August 1990.
- 15. Guidance on Remedial Actions for Contaminated Ground Water at Superfund Sites, U.S. EPA Office of Emergency and Remedial Response (DRAFT), OSWER Directive No. 9283.1-2.
- 16. Guide for Conducting Treatability Studies Under CERCLA, U.S. EPA, Office of Emergency and Remedial Response, Prepublication version.

- 17. Guide to Management of Investigation-Derived Wastes, U.S. EPA, Office of Solid Waste and Emergency Response, Publication 9345.3-03FS, January 1992.
- 18. Guidelines and Specifications for Preparing Quality Assurance Project Plans, U.S. EPA, Office of Research and Development, Cincinnati, OH, QAMS-004/80, December 29, 1980.
- 19. Health and Safety Requirements of Employees Employed in Field Activities, U.S. EPA, Office of Emergency and Remedial Response, July 12, 1982, EPA Order No. 1440.2.
- 20. Interim Guidance on Compliance with Applicable of Relevant and Appropriate Requirements, U.S. EPA, Office of Emergency and Remedial Response, July 9, 1987, OSWER Directive No. 9234.0-05.
- 21. Interim Guidelines and Specifications for Preparing Quality Assurance Project Plans, U.S. EPA, Office of Emergency and Remedial Response, QAMS-005/80, December 1980.
- 22. Methods for Evaluating the Attainment of Cleanup Standards: Vol. 1, Soils and Solid Media, February 1989, EPA 23/02-89-042; vol. 2, Ground water (Jul 1997).
- 23. National Oil and Hazardous Substances Pollution Contingency Plan; Final Rule, Federal Register 40 CFR Part 300, March 8, 1990.
- 24. NIOSH Manual of Analytical Methods, 2nd edition. Volumes I-VII for the 3rd edition, Volumes I and II, National Institute of Occupational Safety and Health.
- 25. Occupational Safety and Health Guidance Manual for Hazardous Waste Site Activities, National Institute of Occupational Safety and Health/Occupational Health and Safety Administration/United States Coast Guard/Environmental Protection Agency, October 1985.
- 26. Permits and Permit Equivalency Processes for CERCLA On-Site Response Actions, February 19, 1992, OSWER Directive 9355.7-03.
- 27. Procedure for Planning and Implementing Off-Site Response Actions, Federal Register, Volume 50, Number 214, November 1985, pages 45933-45937.
- 28. Procedures for Completion and Deletion of NPL Sites, U.S. EPA, Office of Emergency and Remedial Response, April 1989, OSWER Directive No. 9320.2-3A.
- 29. Quality in the Constructed Project: A Guide for Owners, Designers and Constructors, Volume 1, Preliminary Edition for Trial Use and Comment, American Society of Civil Engineers, May 1988.
- 30. Remedial Design/Remedial Action (RD/RA) Handbook, U.S. EPA, Office of Solid Waste and Emergency Response (OSWER) 9355.0-O4B, EPA 540/R-95/059, June 1995.
- 31. Revision of Policy Regarding Superfund Project Assignments, OSWEP Directive No. 9242.3-08, December 10, 1991. [Guidance, p. 2-21]
- 32. Scoping the Remedial Design (Fact Sheet), February 1995, OSWER Publ. 9355-5-21 FS.
- 33. Standard Operating Safety Guides, U.S. EPA, Office of Emergency and Remedial Response, November 1984.

- 34. Standards for the Construction Industry, Code of Federal Regulations, Title 29, Part 1926, Occupational Health and Safety Administration.
- 35. Standards for General Industry, Code of Federal Regulations, Title 29, Part 1910, Occupational Health and Safety Administration.
- 36. Structure and Components of 5-Year Reviews, OSWER Directive No. 9355.7-02, May 23, 1991. [Guidance, p. 3-5]
- 37. Superfund Guidance on EPA Oversight of Remedial Designs and Remedial Actions Performed by Potentially Responsible Parties, April 1990, EPA/54O/G-90/001.
- 38. Superfund Remedial Design and Remedial Action Guidance, U.S. EPA, Office of Emergency and Remedial Response, June 1986, OSWER Directive No. 9355.0-4A.
- 39. Superfund Response Action Contracts (Fact Sheet), May 1993. OSWER Publ. 9242.2-08FS.
- 40. TLVs-Threshold Limit Values and Biological Exposure Indices for 1987-88, American Conference of Governmental Industrial Hygienists.
- 41. Treatability Studies Under CERCLA, Final. U.S. EPA, Office of Solid Waste and Emergency Response, EPA/540/R-92/071a, October 1992.
- 42. USEPA Contract Laboratory Program Statement of Work for Inorganic Analysis, US. EPA, Office of Emergency and Remedial Response, July 1988.
- 43. USEPA Contract Laboratory Program Statement of Work for Organic Analysis, US. EPA, Office of Emergency and Remedial Response, February 1988.
- 45. Value Engineering (Fact Sheet), U.S. EPA, Office of Solid Waste and Emergency Response, Publication 9355.5-03FS. May 1990.
- 46.Clean and Green Policy, US. EPA, Region 10 Superfund, RCRA, LUST, and Brownfields (Regional Policy). August 13, 2009.
- 47. Superfund Green Remediation Strategy, US. EPA Office of Solid Waste and Emergency Response and Office of Superfund Remediation and Technology Innovation. September 2010. (http://www.epa.gov/superfund/greenremediation)
- 48. Guidance on Conducting Non-Time-Critical Removal Actions Under CERCLA, USEPA, Office of Emergency and Remedial Response, EPA/540/R-93/057, OSWER 9360.0-32. August 1993.
- 49. Guidance on Choosing a Sampling Design for Environmental Data Collection for Use in Developing a Quality Assurance Project Plan, USEPA, Office of Environmental Information. December 2002.
- 50.Technical Guides to Streamline Site Cleanup: Smart Scoping, Strategic Sampling and Data Management Best Practices, USEPA, Office of Land and Emergency Management. November 2018.
- 51.EPA Fact Sheet on Evapotranspiration Cover Systems for Waste Containment. February 2011.

- 52. EPA. 1993b. Technical Guidance Document: Quality Assurance and Quality Control for Waste Containment Facilities. September.
- 53. EPA Requirements for Quality Assurance Project Plans (QA/R-5). EPA/240/B-01/003, March 2001, Reissued May 2006.
- 53. EPA Guidance for Quality Assurance Project Plans (QA/G-5). EPA/240/R-02/009), December 2002.
- 54. Intergovernmental Data Quality Task Force, Uniform Federal Policy for Quality Assurance Project Plans. Optimized UFP-QAPP Worksheets. March 2012.
- 55. Intergovernmental Data Quality Task Force, Uniform Federal Policy for Quality Assurance Project Plans. Evaluating, Assessing, and Documenting Environmental Data Collection and Use Programs. Part 1: UFP-QAPP Manual. EPA-505-B-04-900A. March 2005.
- 56. EPA Guidance on Systematic Planning Using the Data Quality Objectives Process. EPA QA/G-4. February 2006.
- 57. Interstate Technology Regulatory Council (ITRC). Technical and Regulatory Guidance for Design, Installation, and Monitoring of Alternative Final Covers. December 2003.
- 58. ITRC Incremental Sampling Methodology. February 2012.
- 59. EPA Technical Guidance Document: Quality Assurance and Quality Control for Waste Containment Facilities. September 1993.
- 60. U.S. Forest Service. Planning and Layout of Small-Stream Diversions. March 2013.
- 61. EPA Region 10 Data Management Plan for Environmental Monitoring and Associated Geospatial Data, Office of Environmental Assessment. June 2014.